

## Latest Vehicle Concern Fixes



| Vehicle        | Customer Concern                                            | Details and Status                                                                                                                                                                                                                                                                                                                                                                     | Publication                                             |
|----------------|-------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------|
| XCL<br>18MY    | Difficulty activating TCU during PDI                        | SSM73634 & SSM73635 should be attempted before opening a TA. New TCU software is available on the current PATHFINDER release to resolve this concern but due to the time required for programming the advice in these SSM's are still regarded as best practice since most vehicles can be activated after multiple attempts.                                                          | SSM73634<br>Jaguar<br>SSM73635<br>Land Rover            |
| F-TYPE<br>18MY | Unable to activate TCU during PDI<br>VINS:<br>K47320-K51945 | Update Prior to Sale UPS9217 campaign (H060) is currently under final review for publication to address discharged TCU backup battery preventing "e-Call" activation during PDI. Until H060 is published, TCU back-up battery replacement is strongly advised <b>BEFORE</b> attempting PDI on F-TYPE in the listed VIN range, in addition to the previously mentioned 18MY XCL advice. | H060<br>to be released by<br>January 12 <sup>th</sup> . |
| XJ<br>18MY     | Unable to activate TCU during PDI                           | 18MY XJ models are still supported by SDD which is currently unable to activate the latest spec TCU fitted to 18MY XJ vehicles. A solution is being prepared for release on SDD152.02 with timing TBD                                                                                                                                                                                  | Release notes for<br>SDD152.02 once<br>released.        |