

Latest Vehicle Concern Fixes



Vehicle	Customer Concern	Details and Status	Publication
All Diesel Engine Variants	A customer may report difficulties with startup in extremely cold temperatures.	This may be due to the development of wax crystals in the fuel which may cause difficulties with startup. As a preventative measure, follow the procedures outlined on the use of DFC fuel additive in the Land Rover & Jaguar bulletins respectively. Please submit an EPQR should a vehicle come in with this issue.	6-373NAS SGI18-02 SSM 73138 SSM 73599
All Diesel Engine Variants	A customer may report that "No Restarts in XXX Miles" is displayed on the instrument cluster during a cold start in only extremely low temperatures.	This could be caused by DEF freezing or beginning to freeze. Should a vehicle come in with this concern, allow the vehicle to sit inside with warmer temperatures for a period of time in order for the DEF to thaw and retest. Please submit an EPQR should this concern be diagnosed.	
RR Sport 16MY Diesel Only	A customer may report a Check Engine Light is illuminated on the instrument cluster.	The CEL may be paired with DTC P2002-00 stored in the PCM for DPF Efficiency. Should any repairs be made on a vehicle with this issue, please submit an EPQR and retain all replaced parts. Engineering may call the parts back for further analysis.	Under Investigation