



Service Bulletin

File in Section: -

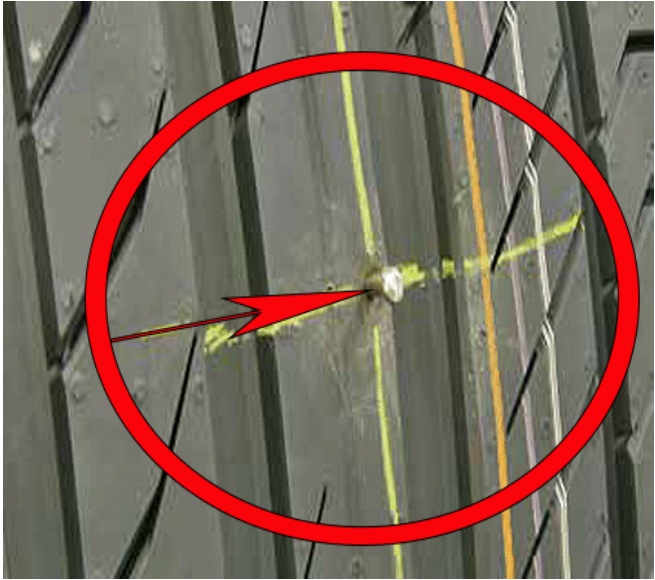
Bulletin No.: 18-NA-010

Date: January, 2018

INFORMATION

Subject: Information on Tire Repair for Continental ContiSilent Tire with Quiet Foam

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Regal	2018	2018				

Involved Region or Country	North America
Condition	Some customers may comment on a tire losing air.
Cause	 <p style="text-align: right;">4926148</p> <p>This condition may be caused by a foreign object puncturing in the tire tread area.</p>

Correction



4926274



4926284

The technician will need to do an additional step prior to doing the tire repair. A piece of foam, 101 mm (4 in) wide, across the whole section of foam located inside the tire, needs to be removed without damaging the inner liner surface.

Important: DO NOT discard the piece of foam that was removed to make the repair. After the repair has been made, the foam has to be reinstalled and can be adhered down with the cement that was used for the plug.

Note: Additional buffing may be needed to completely remove the foam insert adhesive from the inner liner surface.

Version	1
Modified	Released January 12, 2018

