



Service Bulletin

File in Section: -

Bulletin No.: 18-NA-017

Date: January, 2018

TECHNICAL

Subject: Service Headlamp Leveling Illuminated in DIC

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Regal	2018	2018			All	All

Involved Region or Country	North America
Condition	Some customers may comment on seeing the Service Headlamp Leveling illuminated in the DIC.
Cause	The cause of the condition may be that the headlamp control module programming step was completed, however the "Setup" portion WAS NOT completed.
Correction	Verify the Headlamp Control Module programming is current and completed through the Setup portion of the programming. Refer to <i>K26 Headlamp Control Module: Programming and Setup</i> in SI.

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810475	Headlamp Control Module Reprogramming with SPS	0.3 hr*
*The March 1 update of the Labor Time Guide will contain this change.		

Version	1
Modified	Released January 19, 2018

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION