



CR152 Replacement of number plate holder subframe vibration dampers


Models: Panigale V4 2018 (all model versions)

Technical Service Bulletin SRV-TSB-18-007

Date: May 8, 2018
To: Dealer Principal, General Manager, Service Manager, North American Dealer Network
From: Richard Kenton, Technical Director; Eric Bradley, Technical Training and Publications Manager

- **Situation**

On the above listed models, ongoing product quality tests and feedback from the field have identified an opportunity for vehicle improvement. We have decided to introduce 2 new vibration dampers, part no. 76412501A to prevent excessive oscillation. These updates will bring the vehicles listed to the current production configuration.

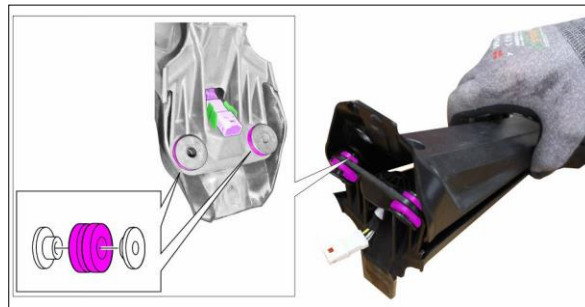

- **Customers**

All bikes in dealer stock ('to be registered' or 'already registered') and awaiting delivery to final Customers will require this inspection during pre-delivery operations; before delivery to the final Customer. All bikes already delivered to final Customers must undergo this inspection and below procedures at the next service appointment.

- **Involved Bikes**

- The list of VIN numbers involved in this campaign (CR152 / SRV-TSB-18-007) can be found in the following DCS locations:

VIN HISTORY		You can consult the single chassis number
CAMPAIGNS		You can consult all the chassis serial numbers that have been sent to you by Ducati Motor Holding.



CR152 Replacement of number plate holder subframe vibration dampers

Models: Panigale V4 2018 (all model versions)

Technical Service Bulletin SRV-TSB-18-007


- **Service Solution**

For the update procedure, follow the instructions below.

- 1) Remove the **2 M5x22 screws (1)** securing the number plate holder assembly to the rear subframe.



- 2) Remove the number plate holder assembly by sliding it down to disengage **tooth (2)** from the relevant rubber support on tail guard.
- 3) Disconnect number plate/rear turn indicator light **connector (3)**.

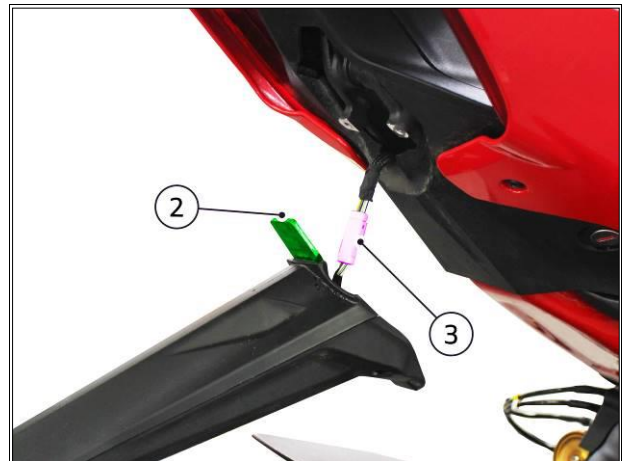




CR152 Replacement of number plate holder subframe vibration dampers


Models: Panigale V4 2018 (all model versions)

Technical Service Bulletin SRV-TSB-18-007

- 4) Place the number plate holder assembly on a clean surface and remove the **M5X16 self-tapping screw (4)** and loosen, without removing, the **3 M5x16 self-tapping screws (5)**.

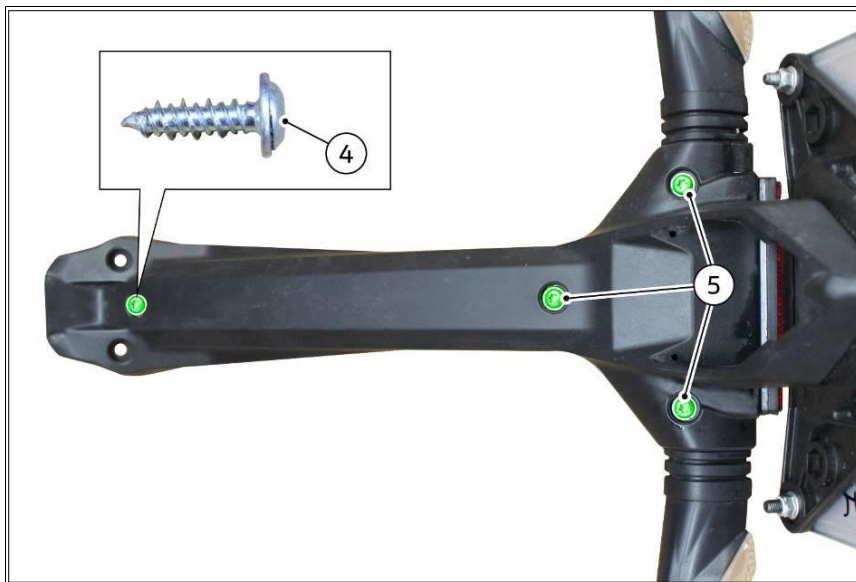

- 5) Remove the **4 upper and lower spacers (6)** with collar, then remove the **2 vibration dampers (7)**.

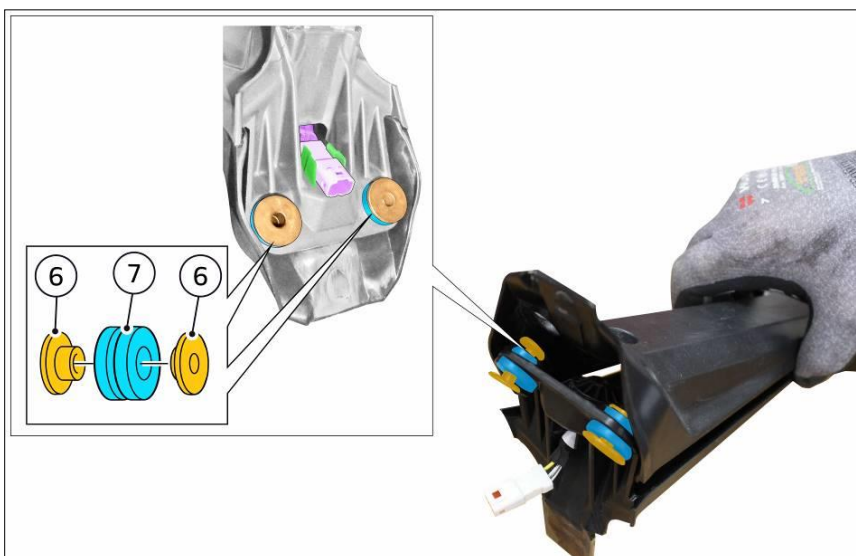




CR152 Replacement of number plate holder subframe vibration dampers


Models: Panigale V4 2018 (all model versions)

Technical Service Bulletin SRV-TSB-18-007

6) Take the 2 new vibration dampers Part no.76412501A.

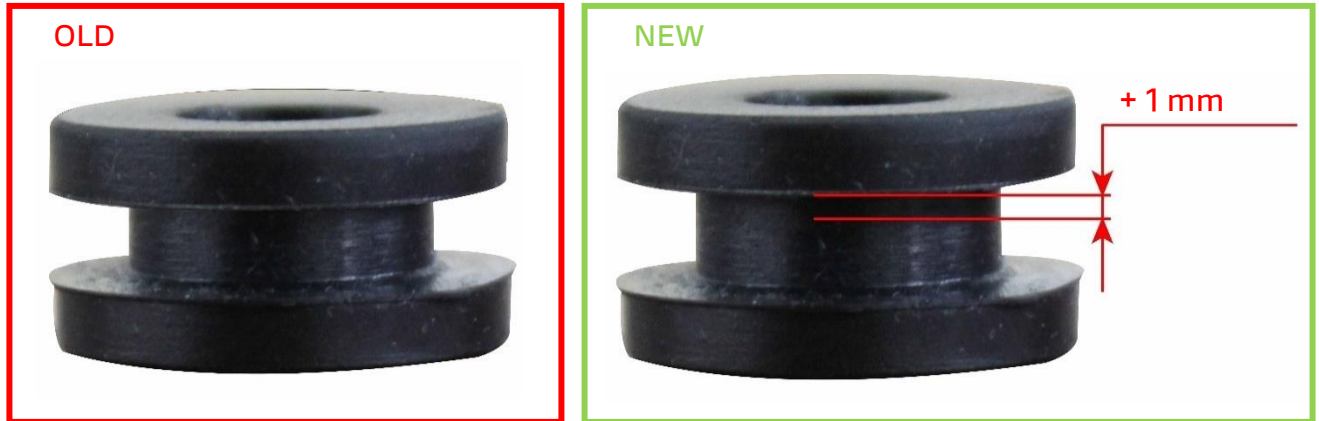

7) Install the 2 new **vibration dampers (A)** inside the holes of the upper number plate support and insert the **4 upper and lower spacers (6)** with collar as shown in the figure.

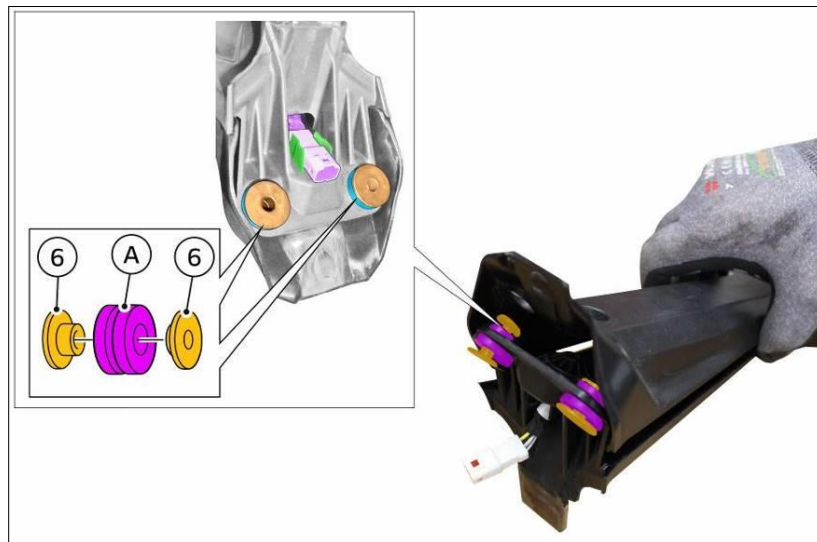

8) Match the upper number plate support with the lower number plate support and start the **M5X16 self-tapping screw (4)**.



CR152 Replacement of number plate holder subframe vibration dampers

Models: Panigale V4 2018 (all model versions)


Technical Service Bulletin SRV-TSB-18-007

- 9) Tighten the **M5X16 self-tapping screw (4)** and the **3 M5x16 self-tapping screws (5)** to **5 Nm $\pm$ 10%**.




NOTE

When matching the upper and lower number plate supports, make sure that the 4 spacers with collar remain seated.

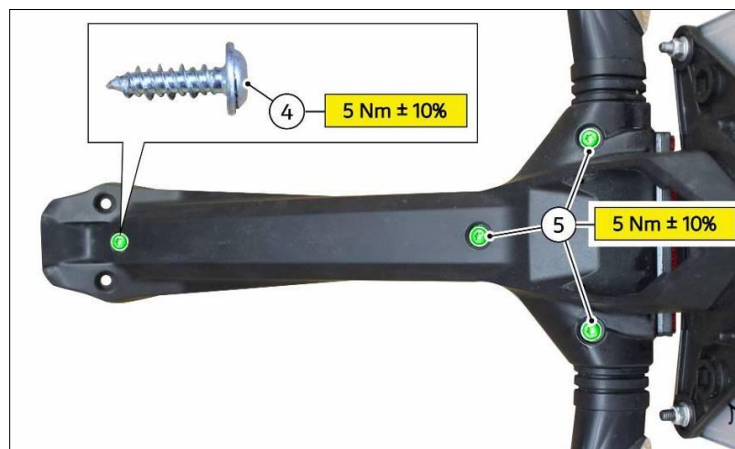

- 10) Connect the number plate/rear turn indicator light **connector (3)**.
- 11) Lubricate the rubber support with KLÜBERPLUS S 06/100 rubber lubricant or equivalent and install the number plate holder assembly by inserting **tooth (2)** inside the rubber support on tail guard.

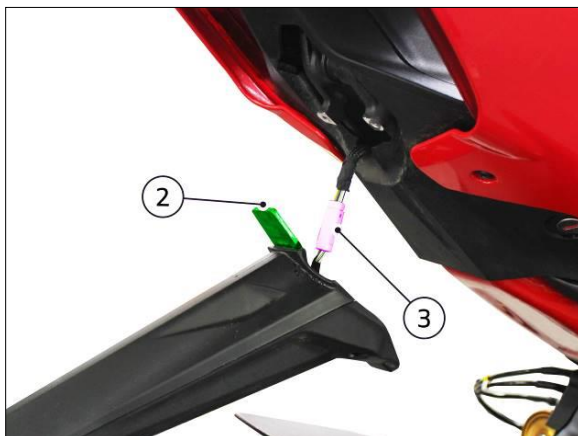



CR152 Replacement of number plate holder subframe vibration dampers

Models: Panigale V4 2018 (all model versions)


Technical Service Bulletin SRV-TSB-18-007

- 12) Tighten the **2 M5x22 screws (1)** securing the number plate holder assembly to the rear subframe to **6 Nm $\pm$ 10%**.



NOTE

Make sure that number plate/rear turn indicator light **wiring (8)** is positioned on tail guard lower cover side opposite to the one showing the seat lock, as shown in the figure.

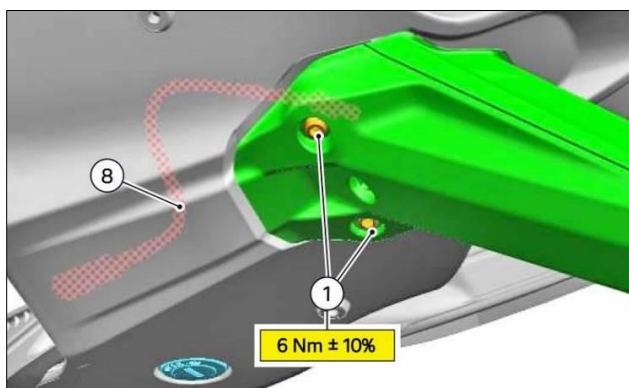

- 13) Check the correct operation of number plate light and rear turn indicators.

• Spare Parts

The spare parts required for this update are listed below:

Part no.	Quantity	Description	Image
76412501A	2	Vibration dampers	

• Warranty

Update procedure reimbursement will be issued through the standard warranty claim procedure via the section **Recall Campaigns** or **Vehicle History** of the DCS; this campaign is identified as **CR152**.

You will be reimbursed:

- for [REDACTED] that includes the time necessary to install the new number plate holder vibration dampers.

Always check in DCS, for the presence of any required updates to be carried out on the vehicle.