



SERVICE ALERT

**SA-17-037 CAMPAIGN AA860 CONNECTING
ROD UPDATE**


**GROUP: 0-GENERAL
BULLETIN NO: SA-17-037
DATE: 4-3-2018**

Release Date:	April 3, 2018
Affected Years:	Certain 2011-2012 MY Conventional Trucks
Affected Models:	Certain Conventional Trucks Equipped with a J08 Engine
Attention:	Service Managers / Service Personnel / Technical Service Managers

SUBJECT: Certain trucks involved with Campaign AA860 may have previously had the connecting rods or engines replaced before this campaign was released. Step 3 of the inspection procedure will be modified as below to verify the date codes on the connecting rods. If the connecting rods were manufactured after 101227 (December 27, 2010), engine repair is not required. The procedure on Hinonet will be adjusted to reflect this change.


3. Record the serial number and date code that appears on the connecting rod cap.

- If only numeric characters are present, check the date code. If the date code is 101227 or later, engine repair is not required. If the date code is 101226 or earlier, engine repair is required. (See photo below at left).
- If any alphabetical characters are present in the serial number, engine repair is not required. (See photos below at right).

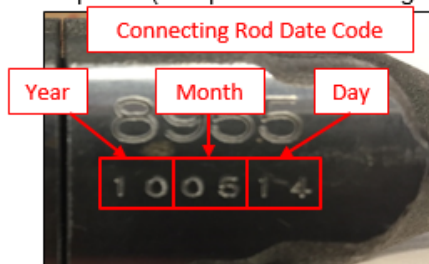

If only numeric characters present, check the date code on the connecting rod:

- 101227 (December 27th, 2010) or later, NO ENGINE REPAIRS ARE REQUIRED.
- 101226 (December 26th, 2010) or earlier, ENGINE REPAIR IS REQUIRED.

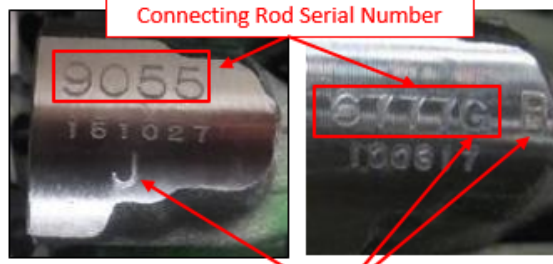

If alphabetic characters are present on the connecting rod, NO ENGINE REPAIRS ARE REQUIRED.

Sincerely,
Your HINO Service Team

