



Preliminary Information

PIC5692D Brake Pedal Does Not Raise after Apply, Brakes Remain Applied or Brake Lights on Unwanted

Product Investigation Review Required

Models

| Brand: | Model: | Model Years: | VIN: | | Engine: | Transmissions: |
|-----------|----------|--------------|------|-----|---------|----------------|
| | | | from | to | | |
| Buick | LaCrosse | 2010 - 2015 | All | All | All | All |
| Buick | Regal | 2011 - 2015 | All | All | All | All |
| Cadillac | SRX | 2010 - 2015 | All | All | All | All |
| Cadillac | XTS | 2013 - 2015 | All | All | All | All |
| Chevrolet | Malibu | 2013 - 2015 | All | All | All | All |

Supersession Statement

This PI was superseded to add SI keywords. Please disregard PIC5692C

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern

In rare cases, a customer or technician may comment the brake pedal may not raise or seem stuck down after a normal braking event.

The condition may occur in high temperature and humidity conditions and may not be repeatable.

Brake lights will remain on and brakes may drag after pedal released.

A pop, click or snap noise may be heard when pedal is applied or released.

If concern is intermittent allow the vehicle to idle for 30 minutes on max heat and floor mode to try and induce the concern. This condition may be due to a bind in the brake pedal pivot bushing.

Recommendations / Instructions

Replace the brake pedal arm.

IMPORTANT: Be sure to use the two (2) new retaining clips that accompany the brake pedal arm.

To identify the correct brake pedal arm to order, please reference the Electronic Parts Catalog for the specific vehicle model and model year being serviced.

Warranty Information

For vehicles repaired under warranty, use:

| Labor Operation | Description | Labor Time |
|-----------------|--|------------------------------------|
| 2441980 | Brake Pedal Assembly Replacement- LaCrosse, SRX, XTS | Use Published Labor Operation Time |
| 2441930 | Brake Pedal Assembly Replacement- Malibu, Regal | Use Published Labor Operation Time |

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

Additional SI Keywords

C0131, C0161, C0277

