



Preliminary Information

 
PIC6334 Battery Saver Active Message Displayed on DIC, Drive Motor Generator Belt Squeal, P0A90 May be Set

Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	LaCrosse	2018	All	All	2.5L (LHN)	MNH
Involved Region or Country	North America					
Condition	Some customers may comment on a Battery Saver Active message displayed on the DIC. When checking the vehicle for DTCs, the generator control module may report P0A90.					
Cause	This may be caused by a Missing Stop Bolt and Brace on the Drive Belt Tensioner.					

Correction:

Please inspect the Lower tensioner for a missing stop Bolt and Brace.
The Below picture shows one installed.



Here is a picture of one missing the bolt and brace.

 

Parts Information

Description	Part Number	Quantity
Brace	24288368	1
Stop Bolt	11549263	1

Warranty Information

Labor Operation	Description	Labor Time
4063010	Drive Belt Tensioner Replacement	Use Published Labor Operation Time

Version History

Version	1
Modified	Created on 5/25/2018.



© 2016 General Motors. All Rights Reserved.