



Preliminary Information

PIT5380C Front Row Seat Back Appears To Lean Outward (Seat Cover Improperly Installed)

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2015 - 2018	All	All	All	All
Chevrolet	Silverado 1500	2014	All	All	All	All
Chevrolet	Silverado	2015 - 2018	All	All	All	All
Chevrolet	Suburban	2015 - 2018	All	All	All	All
Chevrolet	Tahoe	2015 - 2018	All	All	All	All
GMC	Sierra 1500	2014	All	All	All	All
GMC	Sierra	2015 - 2018	All	All	All	All
GMC	Yukon	2015 - 2018	All	All	All	All

Supersession Statement

This PI was superseded to add the 2018 Models, update the Recommendation and Warranty Sections. Please discard PIT5380B.

 
The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern

Some owners may perceive that the front driver's or passenger's seat back may lean or be turned outward, as shown below.




This concern could be caused by the seat bottom trim cover not installed correctly onto the cushion/foam, as shown below. If the seat cover is not completely and squarely installed onto the cushion/foam, it will give the appearance that the seat back is leaning or turned outward.



Recommendations / Instructions


Use the following procedure to correctly install the seat cover and then install a rivet to hold the cover in position.

 1. Remove the seat bottom trim cover and reinstall it completely and squarely to the cushion/foam, as shown below.




2. Reattach the seat bottom cushion cover to the seat cushion frame pan and verify that the cover is now square to the seat back.

 
3. Locate the outboard rear seat cover J-channel retainer (1), as shown below.



 
4. Place a mark on the seat frame pan at the leading edge of the outboard rear seat cover J-channel retainer (2), as shown below.



 
5. Remove the outboard rear seat cover J-channel retainer.



 
6. Position the seat cover up and out of the way to access the mark (3).




 7. Using a 1/8" drill bit, drill a hole through the seat frame pan where marked (4 and 5), as shown below. Be careful to only drill through the seat frame pan.




  8. Install a rivet, GM part number 12558759, into the hole (6 and 7), as shown below.





 9. Reinstall the outboard rear seat cover J-channel retainer (8), as shown below. The rivet will now prevent the seat cover from moving forward, keeping the seat cover aligned.



10. Continue to reassemble the remaining seat parts, which were previously removed.

Parts Information

Part Number	Description	Qty
12558759	Rivet	1

Warranty Information

Labor Operation	Description	Labor Time
7080578	R&R Front Seat Cushion Cover and Install Rivet	SUV - 1.6 hrs PU - 1.1 hrs

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



© 2016 General Motors. All Rights Reserved.