

SS 1033416 New Cascadia ICUC Brake Drag Warning Message Appears For Approximately 3 Seconds When Applying Or Releasing The Parking Brake

Applicable Vehicles


This solution applies to New Cascadia Vehicles.

Issue

In some cases after the Single SAM (SSAM) has been reprogrammed the “Park Brake Drag” message may appear in the ICUC for about 3 seconds, only after applying or releasing the park brake. This can happen if the programming for the “BSC Park Brake Drag” is not set correctly.

Solution

If the “Park Brake Drag” message is being seen for roughly 3 seconds only during the application or releasing of the park brake, then check the programming for the “BSC Park Brake Drag”. The programming for this feature should be set to A0434477458-002- BCS Park Brake Drag –LG3 002. Changing this programming will provide a 15 second delay for the sub parameter PBSC_Parking_Brake_Drag_DelayU16. See screen print below for DiagnosticLink programming for this feature.

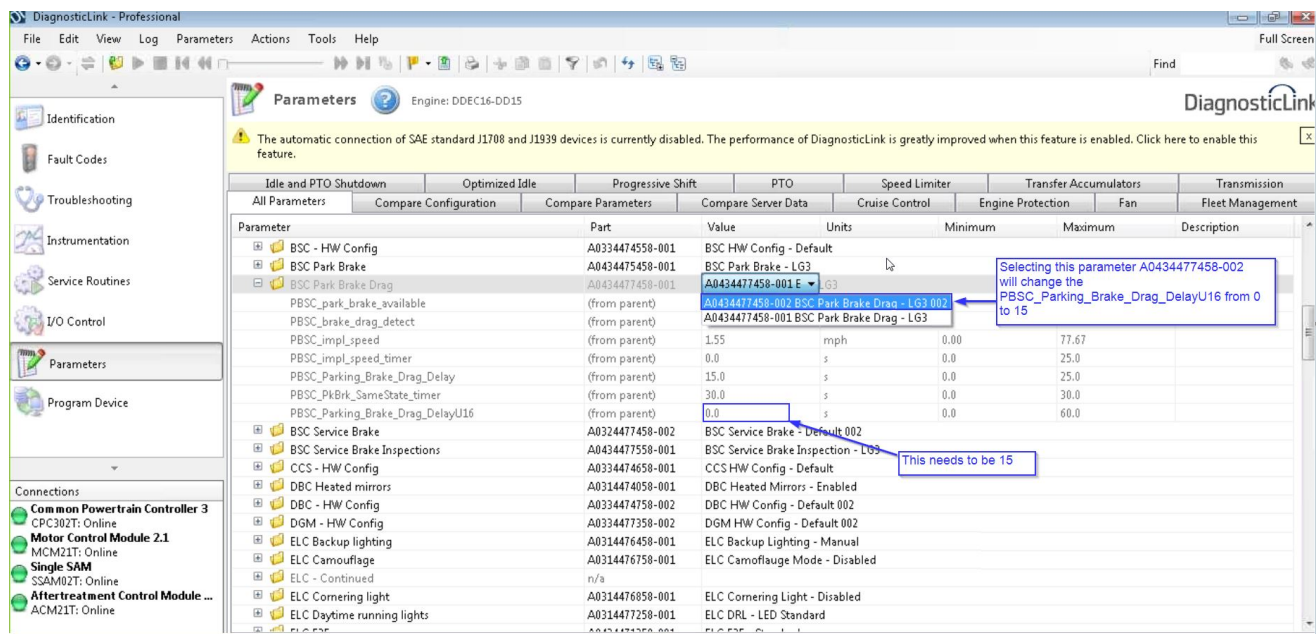

SS 1033416 New Cascadia ICUC Brake Drag Warning Message Appears For Approximately 3 Seconds When Applying Or Releasing The Parking Brake