

XCL	A Customer may report the air conditioner is blowing warm air after a HVAC module software update.	After performing a software update for most current models using Pathfinder the a/c compressor run-in flag becomes reset and the compressor run-in procedure needs to be completed before the HVAC module will engage the compressor clutch. In many cases Pathfinder automatically performs the run-in procedure after the HVAC module is programmed. In other cases the compressor run-in procedure must be performed manually. There has been a few cases reported where after the compressor run-in procedure has been completed successfully the HVAC module does not engage the compressor clutch for an extended period of time. If the vehicle is left locked and sits overnight the HVAC module then engages the compressor clutch normally. This concern is currently under investigation. Should you find that after the compressor run-in routine completes successfully and the compressor clutch is not engaged by the HVAC module until the vehicle is left to sit for an extended period of time, please submit an EPQR for the concern with the PATHFINDER session file attached.	Under Investigation 13
-----	--	---	--------------------------------------