

Symptom - Body Exterior - Filler Flap is Jammed/Stuck: Reworking top centering bar on tank module (SY 32/18)

Model Line: **Panamera (97C) – Sport Turismo**

Model Year: **2018**

Subject: **Tank module**

Symptom: The filler flap is difficult to open or close.

Cause: The gap dimension between the tank cap and seal may be too small, making it difficult to open or close the tank cap.

Remedial Action: Rework the **top** centering bar on the tank module.

Date of Introduction: A modified tank module has been installed during production since October 20, 2017.

Work Procedure: 1 **Preliminary work:**


1.1 Remove filler flap cover.

⇒ *Workshop Manual '553719 Removing and installing filler flap (cap)'*

2 **Rework the top centering bar on the tank module:**

2.1 Remove 1 mm from the **top** centering bar using a suitable tool.

⇒ *Reworking top centering bar on tank module*

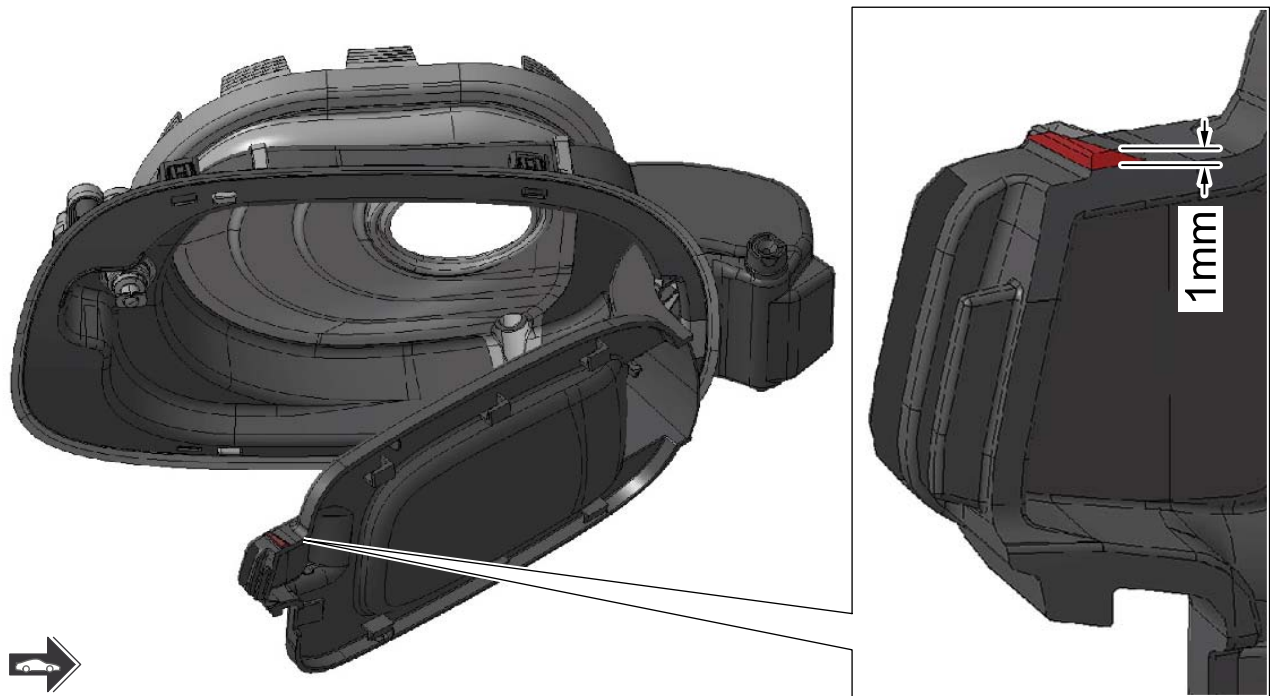

Reworking top centering bar on tank module

3 Subsequent work:

3.1 Install filler flap cover.

⇒ Workshop Manual '553719 Removing and installing filler flap (cap)'

End of action required.

Invoicing: The work involved is invoiced under the labor operation:

APOS	Labor operation	I No.
55374900	Reworking filler flaps	

For invoicing and documentation using PQIS, enter the following coding:

Location (FES5)	55370	Filler flap
Damage type (SA4)	1712	gets jammed/stuck

References: ⇒ Workshop Manual '553719 Removing and installing filler flap (cap)'

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2018 Porsche Cars North America, Inc.