

June 14, 2018

Version 1

Buzzing Coming From the Driver's Door Mirror

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2018	Accord	1.5T ALL	1HGCV1....000001 to 1HGCV1....074299
		2.0T ALL	1HGCV2....000001 to 1HGCV2....008488
		Hybrid ALL	1HGCV3....000001 to 1HGCV3....000171

SYMPTOM

A buzzing is heard from the driver's and/or passenger's door mirror area while driving.

POSSIBLE CAUSES

The rubber seal at the base of the door mirror is not secured.

CORRECTIVE ACTION

Secure the door mirror seal.

TOOL INFORMATION

Tool Name	Part Number	Quantity
Plastic Trim Tool (Pack of 10)	SILTRIMTL10	1

REQUIRED MATERIALS

Part Name	Part Number	Quantity
Weatherstrip Cement (One tube will repair about 100 vehicles.)	08712-0002	1
Masking Tape	Commercially Available	1

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
8200A1	Test-drive to duplicate the noise. Apply weatherstrip cement to either the driver's or front passenger's side door mirror seal.	0.5 hr	03214	04201	A18041B	76258-TVA-A01
A	If repair was required on the opposite side.	0.1 hr				

Skill Level: Repair Technician

INSPECTION PROCEDURE

1. Test-drive the vehicle to duplicate the noise. Click [HERE](#) for an example of the noise.

NOTE

Bring masking tape with you on the test drive.

Were you able to duplicate the noise?

Yes - Go to step 2.

No - This bulletin does not apply. Continue with normal system troubleshooting.

2. Push the mirror housing forward, and tape down the cutline seal to the base as shown.



CUTLINE SEAL



Tape over cutline seal.

3. Return the mirror back to its normal position.



4. Test-drive the vehicle on the same route the noise was originally heard.

Is the noise is still present?

Yes - This bulletin does not apply. Continue with normal system troubleshooting.


No - Go to REPAIR PROCEDURE.

REPAIR PROCEDURE

1. Push the driver's door mirror forward to expose the area of the cutline seal as shown.



2. Lift up the corner of the cutline seal with the appropriate plastic trim tool.

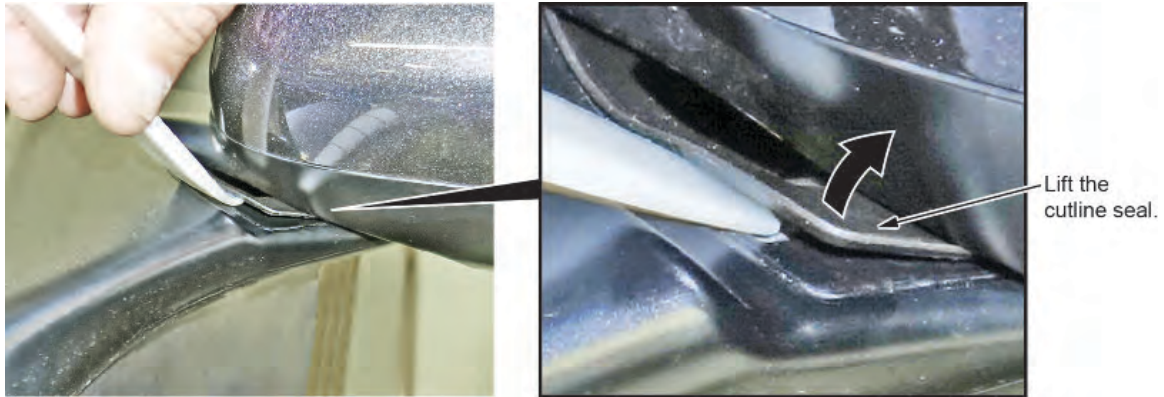

3. Apply a small bead of weatherstrip cement to the bottom of the seal as shown.



4. Line up the cutline seal with the mirror base, then using the plastic trim tool, press and hold down the seal to secure it in place. **Clean off any excess weatherstrip cement.**



5. Return the mirror housing to its normal location.



6. Make sure the noise is gone.

NOTE

Do not wash the vehicle for 24 hours after applying the weatherstrip cement.

END