

| | |
|----------------------|--|
| Reference | SSM72570 |
| Models | Range Rover / L405 Range Rover Evoque / L538 Range Rover Sport / L494 |
| Title | Low Battery Warning Displayed On Instrument Cluster |
| Category | Electrical |
| Last modified | 16-May-2018 00:00:00 |
| Symptom | 203000 Basic Electrical |
| Content | <p>Issue: A customer may report that intermittently a 'Low battery warning' message is displayed on the Instrument Cluster message centre, when the vehicle ignition is switched on after the vehicle has been parked overnight. In addition a clicking noise may be heard from the Rear Junction Box when the ignition is switched on.</p> <p>Cause: Software calculation.</p> <p>Action: If a customer reports the above concern, using Symptom Driven Diagnostics with DVD 144, Patch file 2, Software Management Pack 227 or later loaded, reconfigure the existing Gateway Module.</p> <p>Vehicle VIN range affected:</p> <p>Range Rover Evoque – EH706084 onwards</p> <p>Range Rover Sport – EA000001 onwards</p> <p>Range Rover - EA124982 onwards</p> <p>Technicians - Please rate this SSM and provide comments so that future communications can be improved.</p> <p>1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.</p> <p>3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.</p> <p>5 = Excellent – All required information provided to resolve the customer concern.</p> |