

Entune Audio Head Unit Software Update (Pioneer)

Service Category Audio/Visual/Telematics

Section Navigation/Multi Info Display

Market USA

Toyota Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2018	Camry, Camry HV	

SUPERSESION NOTICE

The information contained in this bulletin supersedes Service Bulletin No. T-SB-0274-17.

- The entire bulletin has been updated.

Service Bulletin No. T-SB-0274-17 is obsolete and any printed versions should be discarded.

Introduction

Some Japan-produced 2018 model year Camry and Camry HV vehicles equipped with Entune™ 3.0 Audio (version 1000) or earlier may exhibit one or both of the following conditions:

- Bluetooth® continuously connects and disconnects
- Inoperative Entune™ voice recognition

Some 2018 model year Camry and Camry HV vehicles equipped with Entune™ 3.0 Audio (version 1021) or earlier may exhibit one or more of the following conditions:

- Unable to update radio
- Software Information screen displays in French
- Phone Number Favorites missing from Home screen
- Intermittent radio freezing
- Software enhancements
- Terms of Service has garbled characters
- Incorrect Entune™ application is recommended for installation on the phone after Bluetooth® pairing
- Certain apps disappear when reordered

A software update is now available to address these conditions. Follow the Software Update Procedure in this bulletin to update the software.

Entune Audio Head Unit Software Update (Pioneer)

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
EL1703	Software Update	0.3	86140-33380 86140-06440	87	74

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Software Update Information

MODEL	HEAD UNIT	SOFTWARE UPDATE FILE
Camry, Camry HV	Entune™ 3.0 Audio	17TDT0NA-EA00_1022.kwi

MULTIMEDIA SOFTWARE FILE DOWNLOAD


The Multimedia software update file may be downloaded directly from this Service Bulletin by clicking on the file name in the table above. Once downloaded, the file may be extracted (unzipped) from the "zip" folder and saved directly to a commonly available blank USB flash drive.

For USB flash drive requirements and download instructions: Refer to *TIS – Diagnostics – Reprogramming – Reference Documents – “[Multimedia Software Download Instructions](#)”*

Software Update Procedure

1. Start the engine.
2. Press the Menu button on the radio faceplate, then select Setup.

Figure 1.

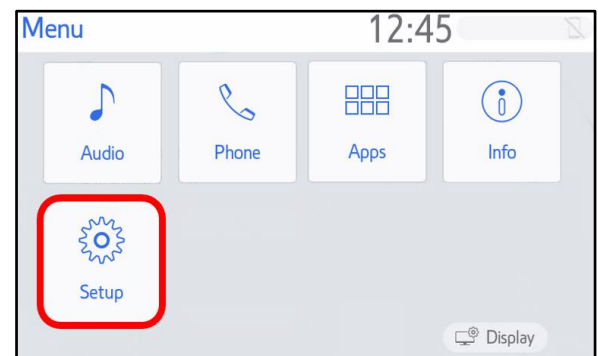


Entune Audio Head Unit Software Update (Pioneer)

Software Update Procedure (continued)


3. Select General on the Setup screen.

Figure 2.

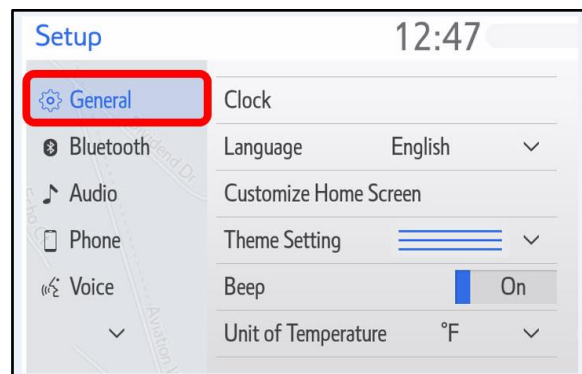


4. Scroll down and select Software Update.

Figure 3.

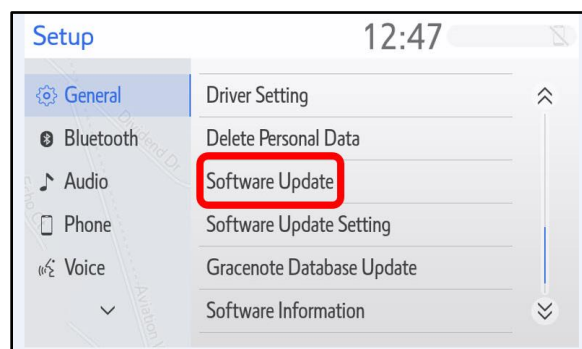

5. Verify that the software version is the same or earlier than indicated in the Introduction.

Figure 4.

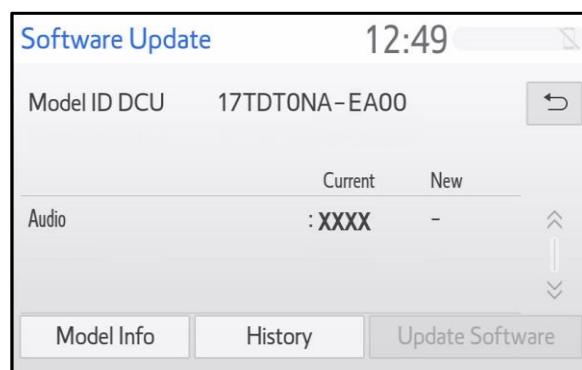

6. If the software needs to be updated, download the software from the Software Update Information section onto an empty USB flash drive.

NOTE


If "IG-OFF" occurs, repeat steps 1 – 4 to re-enter the Software Update screen.

Entune Audio Head Unit Software Update (Pioneer)

Software Update Procedure (continued)

7. Insert the prepared USB flash drive into the vehicle's USB port.

Figure 5.

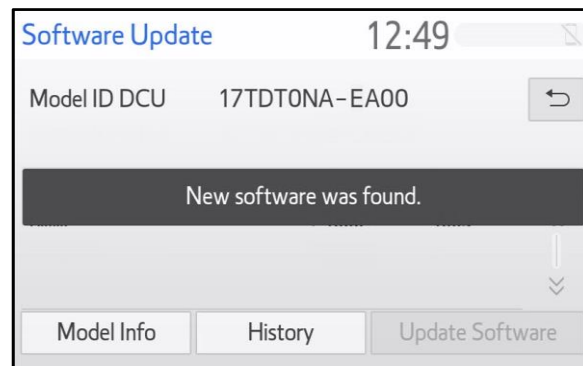


8. Verify that the NEW software is up to date on the Software Update screen.

Table 1. Software Version Information

TYPE	ENTUNE™ 3.0 AUDIO	
	CURRENT VERSION	NEW VERSION
Audio	1000	1022
	1001	
	1021	

9. Select the Update Software button in the lower right-hand corner.

Figure 6.

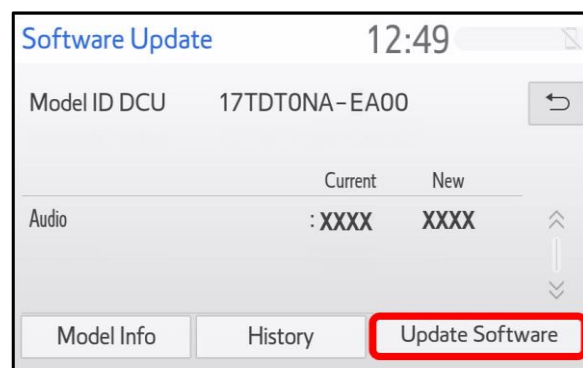


Entune Audio Head Unit Software Update (Pioneer)

Software Update Procedure (continued)


10. Select Ok on the Software Update Detail screen.

Figure 7.

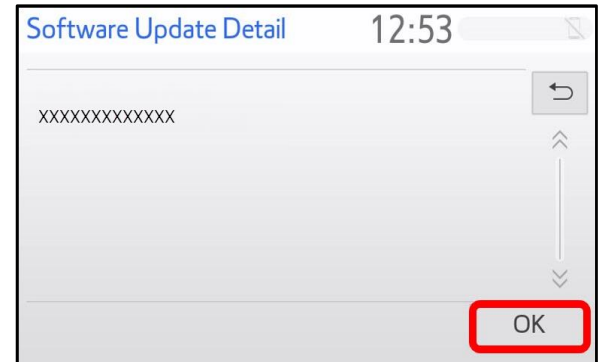


11. Select Agree on the Terms of Service screen.

Figure 8.

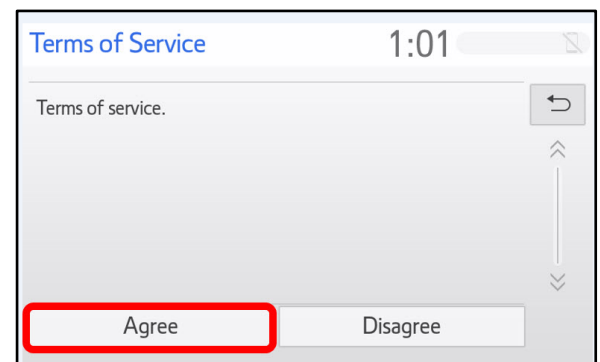

12. Select Yes on the "Would you like to start the software update?" pop-up.

Figure 9.

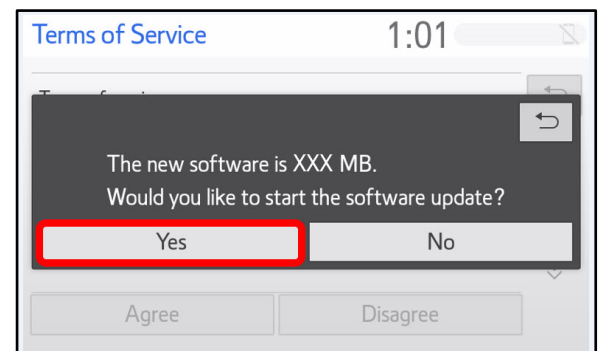

Entune Audio Head Unit Software Update (Pioneer)

Software Update Procedure (continued)

13. Once the head unit begins installation, the update will take approximately 10 minutes.

NOTE

- Do NOT turn off the engine or ACC before the software is ready for updating.
- Do NOT remove the USB flash drive until instructed in step 16.

Figure 10.


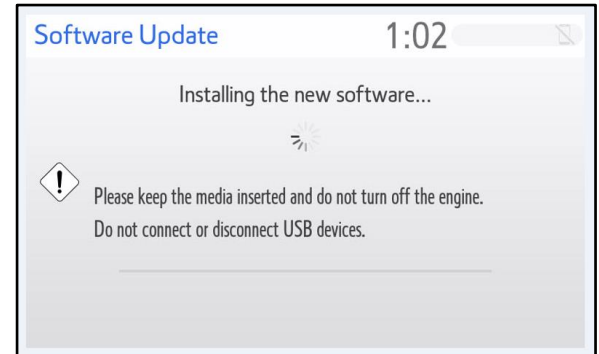


Figure 11.

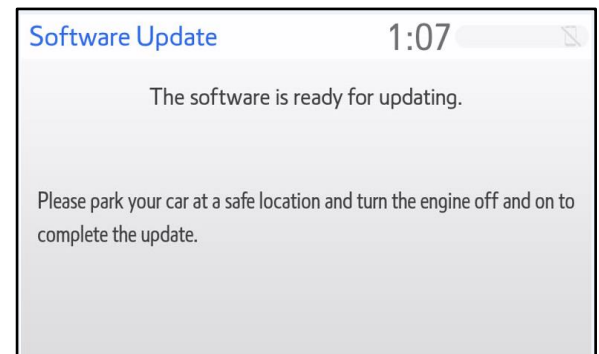

15. Turn the ignition ON to complete the software update.
16. Once the software update is completed, remove the USB flash drive.

Entune Audio Head Unit Software Update (Pioneer)

Software Update Procedure (continued)

17. Perform steps 1 – 4 to verify the software version matches the current software version information table below.

Figure 12.

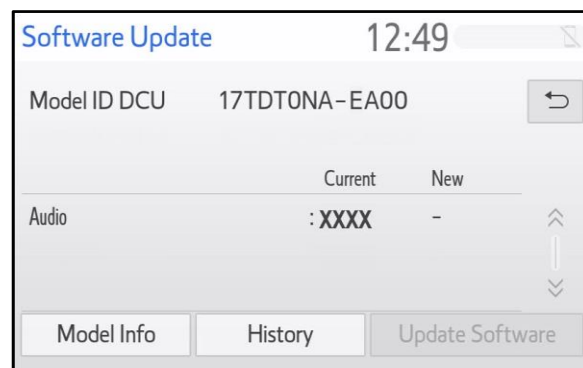


Table 2. Software Version Information

TYPE	ENTUNE™ 3.0 AUDIO	
	CURRENT VERSION	NEW VERSION
Audio	1022	—