
TIS Service Bulletin Page 1 of 2

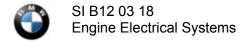

January 2018 Technical Service

NO AUDIBLE DIFFERENCE IN EXHAUST WITH "M PERFORMANCE POWER AND SOUND KIT"

MODEL

II F 311 / 3 Series Senant	F31 (3 Series Sport Wagon)	I F 3 / /4 SOMES (MINE)	F33 (4 Series Convertible)
F34 (3 Series Gran Turismo)	F36 (4 Series Gran Coupe)	G30 (5 Series Sedan)	

Equipped with B58M Engine and BMW M Performance Power and Sound Kit (option code NPOW)

SITUATION

No audible difference in engine exhaust sound is observed when in "SPORT" or "SPORT+" driving modes.

This situation can occur after the vehicle is programmed or retrofitted with the Power and Sound Kit prior to ISTA 4.08.1x.

CAUSE

A software error in the Digital Motor Electronics (DME) exhaust flap electrical controller adaptation process.

CORRECTION

Perform the teach-in function using **ISTA 4.08.1x** or higher.

PROCEDURE

For conditions that are similar to the situation described:

Teach in the exhaust flap position by performing the following test plan:

Select:

- Vehicle management
- Service functions
- Powertrain
- Engine electronics
- Adjustment functions
- Teach-In exhaust flap/move into installation position
- Perform ABL "Teach-In the exhaust flap or move into the installation position"

Note: The function of the exhaust flap can only be checked in driving modes "SPORT" or "SPORT+",

after the vehicle has been in operation for a few minutes.

TIS Service Bulletin Page 2 of 2

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	1812038300		
Labor Operation:	Labor Allowance:	Description:	
00 00 006	Refer to KSD2	Performing "vehicle test" (with vehicle diagnosis system – checking faults) (Main work)	
Or:			
00 00 556	Refer to KSD2	Performing "vehicle test" (with vehicle diagnosis system – checking faults) (Plus work)	
And:			
61 21 528	Refer to KSD2	Connect an approved battery charger/power supply (indicated in KSD 2 as Charging battery)	
And:			
61 00 006	1 FRU	Perform ABL "Teach-In the exhaust flap or move into the installation position"	

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead of 00 00 006.

Refer to KSD2/AIR for the corresponding flat rate unit (FRU) allowances.

Work time labor operation code 61 00 006 is not considered a Main labor operation. Also, since the "work time" FRU allowance to be claimed is specified, a separate punch time is not required.

[Copyright ©2018 BMW of North America, Inc.]