

Special Bulletin

SP18-24

Date	Expiration	Release	Page
05.2018	05.2020	1	1(4)

First Release

2018-06-21

BELLEVILLE WASHER ADDITION ON SLIDE-OUT

Prevost vehicles

DESCRIPTION

On the vehicles affected by this bulletin, add Belleville washers on the leveling screws of the front right slide-out.

MODEL YEAR(S) AND VEHICLES INVOLVED

NOTICE TO SERVICE CENTERS	
<i>Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.</i>	
Model	VIN
H3-45 VIP motorhomes Model Year : 2018	Individual vehicles 2PCVS3493JC710191 And 2PCVS3495JC710113.
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery.	

MATERIAL NEEDED


Order the following parts:

Part No.	Description	Qty
5002082	WASHER BEL SPR 16.3x31.0x2.0 N500	4

NOTE

Material can be obtained through regular channels.

PROCEDURE

 DANGER
Park vehicle safely, apply parking brake, stop engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.

1. Close the slide-out. Locate the tilting and leveling plates under the slide-out on each side. (Arrow, Figure 1)

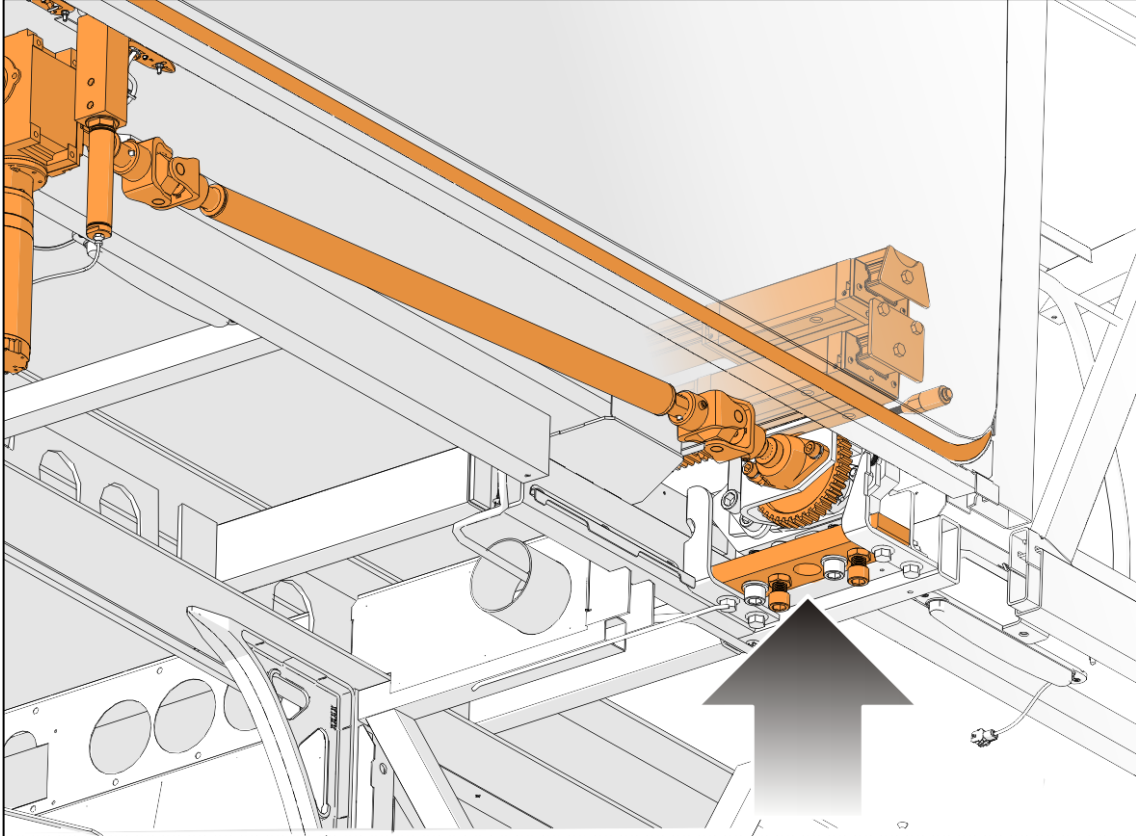


Figure 1: Tilting and leveling plate (Front plate shown)

2. Inside the vehicle, remove the front passenger's seat (if present) and remove the slide-out mechanism access hatch behind the seat.



Figure 2: Access hatch

Date	Expiration	Release	Page
05.2018	05.2020	1	3(4)

3. Use a mirror and light to locate the screws.(Figure 3)



Figure 3: Using a mirror to locate the screws

IMPORTANT: To preserve the slide-out adjustment, follow the proposed removal order, screw A then screw B.

4. Remove screw **A** (Figure 4).
5. Add missing washer 5002082.
Tighten to **55-65 lb-ft (75-88 Nm)**
6. Remove screw **B** (Figure 4).
7. Add missing washer 5002082.
Tighten to **55-65 lb-ft (75-88 Nm)**
8. Re-install access hatch and seat.

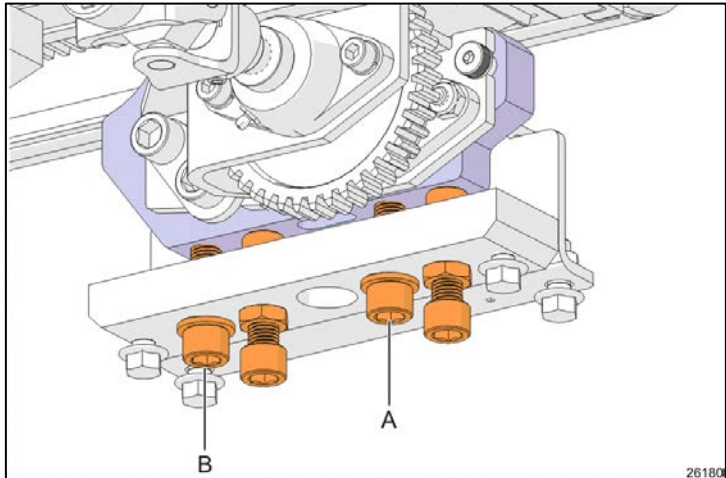


Figure 4: Leveling screws

9. Proceed to second levelling plate, rear of the slide-out.
10. From the cargo bay, remove the black plastic panel attached to the ceiling. (Figure 5)
11. Repeat steps 4 to 7
12. Re-install black plastic panel (Figure 5)



Figure 5: Black plastic panel

Date	Expiration	Release	Page
05.2018	05.2020	1	4(4)

PARTS / WASTE DISPOSAL

Discard waste responsibly according to applicable environmental regulations (Municipal/State[Prov.]/Federal)

ESTIMATED TIME

The time required to perform this special bulletin is approximately one hour.

OTHER

VBC Bulletin	N/A
Fail Code	26.03
Defect Code	09
Syst. Cond	B
Causal Part	491366

Access all our Service Bulletins on
<http://techpub.prevestcar.com/en/>
or scan the QR-Code with your smart phone.



Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Prevost, however, is not committed to, or liable for updating existing products.