

Advanced Technical Information

Panamera S Hybrid

1303

4777

4

Fault P055600 Brake Vacuum System: Mechanical Fault Stored in DME (1303)

This bulletin replaces bulletin Group 4, #1303, dated April 4, 2016. 958 615 008 01 was added to Parts Information.

Vehicle Type: **Panamera S Hybrid (970)**


Model Year: **2012 - 2013**

Concern: **Check Engine and Hybrid warning illuminated**

Information: If the fault P055600 is stored in the DME, the brake booster vacuum system must be function tested as per the information in Guided Fault Finding and Diagnosis Information.

If no electrical or vacuum faults are found after following Guided Fault Finding and Diagnosis Information, the fault may have been set by an intermittent stuck open pump relay or check valve in the vacuum lines. The pump relay and three vacuum lines containing check valves should then be replaced.

If the fault is not resolved after following Guided Fault Finding, Diagnosis Information, and replacing the relay / vacuum lines containing check valves, please submit a PTEC-TLAR for additional support.

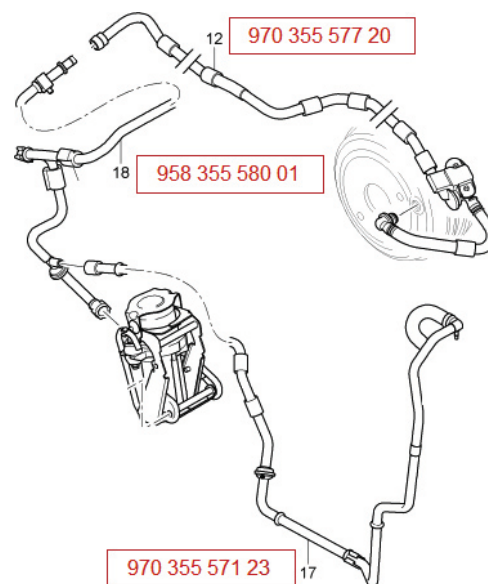

Parts Info:

970 355 577 21	Vacuum Line with check valve
970 355 571 23	Vacuum Line with check valve
958 355 580 01	Vacuum Line with check valve
958 615 008 01	Relay Vacuum Pump

Labor:

03350050	On Board Diagnostic	10 TU
03350053	On board Diagnostic	14 TU
50871900	Cover removed and reinstalled	80 TU
10831910	Engine cover removed and reinstalled.....	19 TU
47771999	Vacuum lines/Relay replace	150 TU

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.