



# Preliminary Information

## PIT5620 Itch Rattle Flutter Squeak Tick Chirp Type Noise from the Drivers Side A Pillar Area


Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2016 - 2018	All	All	All	All
Chevrolet	Suburban	2016 - 2018	All	All	All	All
Chevrolet	Tahoe	2016 - 2018	All	All	All	All
GMC	Yukon	2016 - 2018	All	All	All	All

Involved Region or Country	North America
----------------------------	---------------

Condition	Some customers may comment of an itch, rattle, flutter, squeak, tick, and/or chirp type noise coming from the left I/P or A-pillar area. This noise may be temperature related and is heard while driving and hitting small bumps.
-----------	--

Cause	This concern could be caused by contact (3) between the left fender (2) and the bottom of the A-pillar (1), as shown below.
-------	---

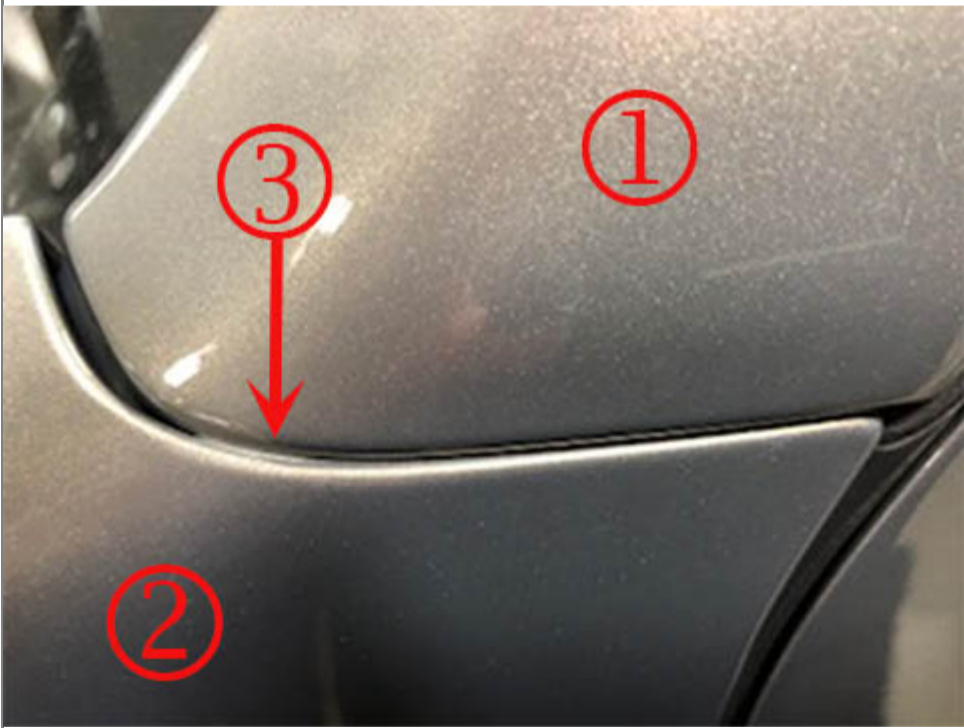

**Correction:**

To correct this concern adjust the fender. In some cases, the use of a trim tool can be used to adjust/finesse the fender flange to provide clearance to the A pillar through the door opening.

**Note: This PI will be converted into a bulletin when new information is available.**

**Version History**

Version	1
Modified	Created June 11, 2018



© 2018 General Motors. All Rights Reserved.