



Preliminary Information

PIT5565A Squeak/Squawk Noise When Turning Steering Wheel

Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2015 - 2018	All	All	All	All
Chevrolet	Silverado 1500	2014 - 2018	All	All	All	All
Chevrolet	Suburban	2015 - 2018	All	All	All	All
Chevrolet	Tahoe	2015 - 2018	All	All	All	All
GMC	Sierra 1500	2014 - 2018	All	All	All	All
GMC	Yukon	2015 - 2018	All	All	All	All

Involved Region or Country	North America
Condition	Some owners may comment that when turning the steering wheel they may hear a squeak/squawk noise from the driver's foot well area.
Cause	Lack of lubrication where the intermediate shaft passes through the engine bulkhead I-shaft boot.

Correction:

If normal SI diagnostics does not lead to a correction, follow the procedure as outlined below.

From inside of the vehicle, locate where the steering column I-shaft passes through the engine bulkhead I-shaft boot. Apply a liberal amount of lithium based grease where the I-shaft contacts the rubber boot as shown in picture below.

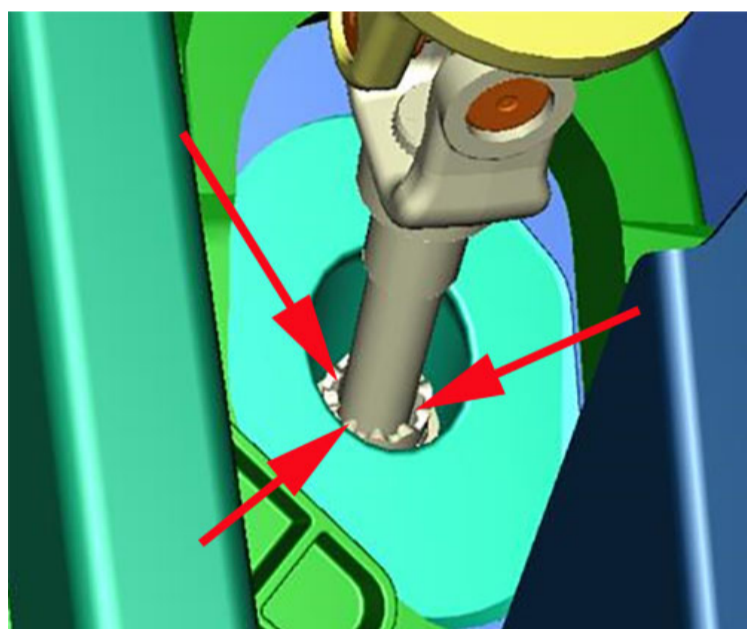

Warranty Information

Labor Operation	Description	Labor Time
7480308*	Lubricate The Intermediate Shaft Pass Through Boot	0.3
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	2
Modified	Created 05/01/2017. 06/12/2018-Updated to add 2018 Model Year.



GENERAL MOTORS