



Preliminary Information

PIP5572 SES or Check Engine Light with Injector Timing Related DTCs

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado	2017 - 2018	All	All	6.6 L5P	All
GMC	Sierra	2017 - 2018	All	All	6.6 L5P	All

Involved Region or Country:	North America
Condition:	Some customers may comment on a Service Engine Soon Light/Check Engine Light on.
Cause:	Technician may find any combination of DTCs P01CB, P01CC, P01CD, P01CE, P01CF, P01D0, P01D1, P01D2, P01D3, P01D4, P01D5, P01D6 P01D7, P01D8, P01D9, P01DA, P02CC, P02CD, P02CE, P02CF, P02D0, P02D1, P02D2, P02D3, P02D4, P02D5, P02D6, P02D7, P02D8, P02D9, P02DA, P02DB set.

Correction:

Please address any vehicle or engine vibrations and any other vehicle concerns before proceeding with this PI. Vehicle vibrations and "Knobby" or aggressive tread tires have been shown to induce or aggravate injector timing related DTCs.

DO NOT replace injectors for these DTCs.

Please clear the DTC(s) and return the vehicle to the customer.

GM engineering is aware of a concern and is investigating.

This Preliminary Information will be updated when further information is available.

Version History

Version	1
Modified	Created on 6/26/2018



GENERAL MOTORS