

C18, FILTER AS.-FUEL, LEAKS FUEL, (1R-0749)

(Status Updated: 16Jul2018)

CPI Number: 425598

Status: Open , Active

6 Sigma Phase: Analyze

Commercial Impact:

Initial Project Activation Date: 11Jul2018

Target Completion Date: 31Dec2018

Models:

(120K), (120K 2), (12K), (336E L), (336F L), (336F LXE), (3406C), (3412),
 (3412C), (349E), (349F L), (352F (VG)), (374F L), (730C), (730C 2), (745C),
 (770G), (772G), (950H), (962H), (966H), (980M), (982M), (988K),
 (C13), (C15), (C18), (C9), (C9.3), (D6N XL), (D6T), (D6T LGP),
 (D6T LGP PAT), (D6T XL), (D8R), (D8T), (D9T),

Symptom/Description:

The fuel filter 1R-0749 is leaking at the top plate. This usually occurs when the filter is new. It can happen where ever the filter is used. These leaks are small leaks.

Part Number:

1R-0749 (FILTER AS.-FUEL)

Dealer Status:

We have identified the issue and have made change to the piece part cross section to eliminate the thin wall that was causing leaks because of porosity. WE are currently testing these new parts in our lab.

Interim Action Info:

Repair Type: Field

Repair Action: Inspect and replace with good part. Please retain failed parts and check Send It Back for an open Parts Return Request.

Repair Eff S/N: 2L7[00001-99999], 2T4[00001-99999], 38S[00001-99999], 5AG[00001-99999], 9EM[00001-99999], BJ6[00001-99999], BS6[00001-99999], C2G[00001-99999], C5L[00001-99999], D9N[00001-99999], DH4[00001-99999], DNM[00001-99999], ECM[00001-99999], F9A[00001-99999], FMC[00001-99999], GCT[00001-99999], HTZ[00001-99999], J8B[00001-99999], JJA[00001-99999], JLE[00001-99999], K1Y[00001-99999], KDH[00001-99999], KEX[00001-99999], KMR[00001-99999], KRA[00001-99999], KRS[00001-99999], L8D[00001-99999], LJR[00001-99999], LNB[00001-99999], LRS[00001-99999], LTP[00001-99999], LWX[00001-99999], MXL[00001-99999], N3F[00001-99999], N5F[00001-99999], NAP[00001-99999], NKM[00001-99999], RAD[00001-99999], REH[00001-99999], RGH[00001-99999], RJS[00001-99999], SGT[00001-99999], SMC[00001-99999], SSA[00001-99999], SZN[00001-99999], SZS[00001-99999], T4A[00001-99999], TFF[00001-99999], TFK[00001-99999], TWX[00001-99999], WTZ[00001-99999], YCE[00001-99999], HPD[00001-99999], NDC[00001-99999], A9J[00001-99999], BZ2[00001-99999], RKB[00001-99999], YEG[00001-99999], TZA[00001-99999]

Pub Type: No Data Available.

Pub Number: No Data Available.

Pub Date: No Data Available.

Root Cause:

1: Porosity in the top plate of the filter element in some cause can result in a leak.

Caterpillar Confidential: Yellow

[CPI IT Help Desk](#)

[Data Privacy](#)

Last Updated: Fri Aug 3 16:08:35 CDT 2018

© Copyright 2018 Caterpillar Inc., All Rights Reserved.