




# Preliminary Information

## PIP5577 Metal Shavings In The Oil Filter On First Oil Change

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CT6	2016 - 2018	All	All	3.0 LGW, 3.6 LGX	All
Cadillac	XT5	2017 - 2018	All	All	3.6 LGX	All
GMC	Acadia	2017 - 2018	All	All	3.6 LGX	All

Involved Region or Country	North America
Condition	<p>You may find aluminum metal machining chips or curls on the top of the oil filter when performing the first oil change on a new vehicle.</p> 
Cause	These aluminum chips are from the machining process when drilling out the holes for the engine oil cooler.
Correction	<p>This debris is on the intake or dirty side of the oil filter and will not go into the engine.</p> <p><b>NOTE: DO NOT replace the engine because of this debris.</b></p> <p>Change the oil and filter and return the car to the customer.</p>

**NOTE: As further information becomes available this PI will be updated or replaced with a bulletin as needed.**

Version History

Version	<b>1</b>
Modified	Created 07/16/2018



© 2018 General Motors. All Rights Reserved.