

REFERENCE NO: RF-18-01R1

DATE: June 18, 2018

SUBJECT: 2017-2018 CX-5 – BLIND SPOT MONITORING (BSM) CONTROL MODULE

If one of the blind spot monitoring (BSM) control modules has to be replaced on a 2017-2018 CX-5, inspect the labels (1) and (2) on the modules (P/N KB8C-67Y30E). Modules that have an “A9” label cannot be used with modules that have an “A8” and are no longer available.

- If both modules have an “A8” 2 digit alphanumeric label:
 - Replace just the bad "A8" module with an “A8” module P/N is KB8C-67Y30E
 - or
 - Replace just the bad "A8" module with P/N KB8C-67Y30F (suffix F) or later.
- If both modules have an “A9” 2 digit alphanumeric label:
 - Replace both “A9” modules with “A8” modules P/N is KB8C-67Y30E
 - or
 - Replace just the bad “A9” module with P/N KB8C-67Y30F (suffix F) or later.

