

## Height adjustment of electric steering column adjustment does not operate

---

Topic number	LI46.15-P-063353
Version	3
Function group	46.15 Steering column adjustment
Date	05-07-2018
Validity	Model 166 Model 205 Model 213 Model 217 Model 238 Model 253 Model 257 Model 292
Reason for change	Remedy revised
Reason for block	

---

### Complaint:

Height adjustment of electric steering column adjustment sticks in adjustment position at top limit stop.

### Cause:

Cause is under investigation. Thus, before processing the vehicle, please provide a control unit log of the seat control unit and send it through a PTSS case.

### Remedy:

1. Prepare control unit protocol for driver's seat and send through a PTSS case.
2. Move fore/aft adjustment to the end position.
3. Unstick the height adjustment by knocking with palm of hand on the top of steering wheel.

At the same time, push adjusting switch (downwards).

4. Commission driver's seat control unit.

While doing so,

- the control unit software is updated, if necessary
- the limit stops are cleared and normalized again.
- and any renewed jamming is prevented

5. Once commissioning has been completed the vehicle can be released.

### Symptoms

---

# XENTRY TIPS

---

Chassis/suspension / Steering system / Steering column adjustment / Malfunction
Chassis/suspension / Steering system / Steering column adjustment / Does not adjust longitudinally
Chassis/suspension / Steering system / Steering column adjustment / Does not adjust in height
Chassis/suspension / Steering system / Steering column adjustment / Adjusts without obvious cause

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			46236 D6	Steering column adjustment motor for height adjustment has excessive resistance