

AMG front splitter cracked in the middle

Topic number	LI88.20-P-067779
Version	1
Function group	88.20 Bumpers
Date	03-01-2018
Validity	BR117 with code 772 and code P55/P60
Reason for change	
Reason for block	

Complaint:

Front splitter cracked/broken in the middle (see attachment, picture 1).

Attachments	
File	Description
Riss_Frontsplitter.JPG	Picture 1

Cause:

Front splitter may have been installed under stress.

Remedy:

If the manufacturing date of vehicle is after September 4 2017: Create a PTSS case with pictures of damage for further instruction.

If the manufacturing date of vehicle is on or before September 4 2017 : Check front splitter for effects of external influence.

If no signs of external force are visible, replace the front splitter (as per sub-steps in WIS document ar88.20-p-2000nkb).

Symptoms
Body / Bumper / Poor fit

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 117 885 50 01			Center lower front bumper trim	1	Valid for code P55	X
A 117 885 51 01			Center lower front bumper trim	1	Valid for code P60	X

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note

XENTRY TIPS

		88337 07	
--	--	----------	--

Attachments

Riss_Frontsplitter.JPG:

