

Plug-in hybrid fuel filler flap will not open

Topic number	LI88.60-P-067847
Version	1
Function group	88.60 Exterior flaps
Date	03-12-2018
Validity	W205 (Produced before Jan 22 2017), S205 (Produced before Nov 21 2017), X253 (Produced before Nov 20 2017), C253 (Produced before Nov 5 2017), W213 (Produced before Nov 17 2017), W166 (Produced before Jan 29 2018) S213, W222
Reason for change	
Reason for block	

Complaint:

Plug-in hybrid socket flap at rear bumper will not open at temperatures in freezing conditions.

Cause:

Central locking system actuator frozen.

Remedy:

Remove rear bumper. Install optimized central locking system actuator as well as pin.

Note:

For all affected model series, the optimized parts are available in the spare parts area

Symptoms
Body / Door/Flap / Fuel filler flap / Jammed

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 820 62 05			Locking system Actuator	1	Charging socket plug actuator	X
A 222 820 32 97			Locking system Actuator	1	Charging socket plug pin	X

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			63009 14	Fuel filler flap/socket flap ejector catches

XENTRY TIPS
