

Load compartment cover does not move upwards when liftgate is opened

Topic number	LI68.50-P-062299
Version	2
Function group	68.50 Curtains, roller blinds, luggage net
Date	03-14-2018
Validity	BR 212.2
Reason for change	Remedy revised
Reason for block	

Complaint:

The attached load compartment cover does not move upwards when the liftgate is opened.

Cause:

A magnet is integrated in the guide pin on the right of the load compartment cover. The right guide rail is fitted with a Hall sensor to detect this magnet. When the load compartment cover is engaged, the Hall sensor detects the magnet in the guide pin.

If the magnet is not detected, the load compartment cover may not move upwards when the liftgate is opened.

Pic 1: OK/magnet present

Pic 2: Not OK/magnet not present

Attachments	
File	Description
pic 2.JPG	Magnet is not present
pic 1.JPG	Magnet is present

Remedy:

Check whether the magnet is present in the passenger-side guide pin.

If not, the right guide pin must be replaced. (See Pic 3)

Attachments	
File	Description
pic 3.JPG	Replace guide pin

Symptoms
Body / Interior equipment / Cargo area cover/twin roller blind / Does not run up
Body / Interior equipment / Cargo area cover/twin roller blind / Nonfunctional
Body / Interior equipment / Cargo area cover/twin roller blind / Stiff movement/jammed

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC

XENTRY TIPS

A 212 812 06 01		9051	Right guide pin	1		X
A 212 812 05 01		9051	Left guide pin	1		X

Attachments

pic 2.JPG:



pic 3.JPG:



XENTRY TIPS

pic 1.JPG:

