

Trunk lid cannot be closed

Topic number	LI80.61-P-068096
Version	1
Function group	80.61 Keyless-Go/Keyless-Entry
Date	05-11-2018
Validity	Model series 257 ... A000277 to A 002344
Reason for change	
Reason for block	

Complaint:

The trunk lid cannot be closed if the key is too close to the trunk. The key may be detected as being in the vehicle by mistake.

Cause:

Possibly incorrect closing parameters

Remedy:

Perform SCN coding for Keyless Go control unit again.

Symptoms

Body / Door/Flap / Hood/flap / Trunk lid/liftgate / Does not close

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
54-0992	CODE CONTROL UNIT ... (AFTER QUICK TEST)		82190 90	
54-0650	ON-BOARD POWER SUPPLY MAINTAIN			
54-1011	PERFORM QUICK TEST			