

Temporary fault message for all assistance systems in the IC

Topic number	LI42.47-P-067880
Version	3
Function group	42.47 Adaptive Brake (ABR)
Date	05-11-2018
Validity	Model series 213 AMG-Sport (E43 AMG-Sport)
Reason for change	Remedy available.
Reason for block	

Complaint:

Temporary fault message for all assistance systems in the IC.

Note:

The ESP control unit (N30/4) contains the following code (DTC) - U1118FD

Cause:

Possibly software of the powertrain control unit ((PTCU) (N127)).

Remedy:

Modified software is available for the PTCU control unit.

Note:

Use current XENTRY DVD and all available add-ons.

Symptoms
Communication/information / Warning and control system / Distronic / Display message / Function error
Communication/information / Warning and control system / Lane Assistant / Malfunction, displays
Communication/information / Warning and control system / Speed Limit Assist / Malfunction
Communication/information / Warning and control system / COLLISION PREVENTION ASSIST / Warning message in instrument cluster
Communication/information / Warning and control system / COLLISION PREVENTION ASSIST / Malfunction, warning system
Communication/information / Warning and control system / Lane Assistant / Warning message in instrument cluster
Communication/information / Warning and control system / Blind spot assist / Warning message in instrument cluster
Communication/information / Warning and control system / Blind spot assist / Malfunction
Chassis/suspension / Brake system / Brakes/traction regulation system / Electronic Stability Program (ESP) / Display message

XENTRY TIPS

Control unit/fault code		
Control unit	Fault code	Fault text
N30/4 - Electronic stability program (ESP®) (ESP213)	U1118FD	The traction system has detected implausible data 1. _

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
54-0650	ON-BOARD POWER SUPPLY MAINTAIN			
54-1011	PERFORM QUICK TEST			
54-0991	UPDATE SOFTWARE PTCU N127		5440Z 90	