



Countries:	CANADA, UNITED STATES	Document ID:	IK1600227
Availability:	ISIS, IsSIR	Revision:	5
Major System:	CAB / SLEEPER / HOOD	Created:	7/13/2017
Current Language:	English	Last Modified:	7/31/2018
Other Languages:	NONE	Author:	Steven Bautz
Viewed:	1203		

[Less Info](#)

Hide Details

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		 View My Bookmarks				 9	 1

Title: Loose, Missing, or Damaged Glass in the LT Hood Mounted Mirror

Applies To: LT

CHANGE LOG

Please refer to the change log text box below for recent changes to this article:

7/31/2018 - Changed SRT Code from A16-515 to LT Specific.

7/30/2018 - Updated to reflect epoxied glass as of Nov 2017.

4/19/2018 - Author updated for feedback purposes

12/08/2017 - Author changed for feedback purposes

11/30/2017 - Added optional replacement of mirror assembly

07/14/2017 - Initial Article Release

DESCRIPTION

This document will guide the user through the inspection and replacement of the hood mounted mirror assembly. (Glass ONLY replacement is no longer serviceable.) As of November 2017, the design for the mirror glass attachment has changed to be permanently epoxied into the housing.

SYMPTOM(s)

Loose or missing glass from the hood mounted mirror. (Can be either black or chrome mirror assemblies)

SERVICE PARTS INFORMATION

Description	Part Number
Carrier, Glass Only	Not Serviceable
Hood mirror Assembly	3765560C95 LH Black 3765561C95 RH Black 3765562C95 LH Bright 3765563C95 RH Bright

REPAIR / INSPECTION STEP(s)


Inspect the condition of the mirror assembly. If the mirror is either loose or missing, the complete mirror assembly (Head & Arm) will need to be replaced.

Note: The replacement mirror assemblies have the glass epoxied in place. Going forward all LT hood mirror glass panels will not be serviceable separately. The entire mirror assembly (Head & Arm) will need to be replaced.

Complete Mirror Replacement Procedure

1. Open hood to gain access to the the mirror assembly mounting hardware.
2. Remove 4 fasteners (Figure 1, item 1).



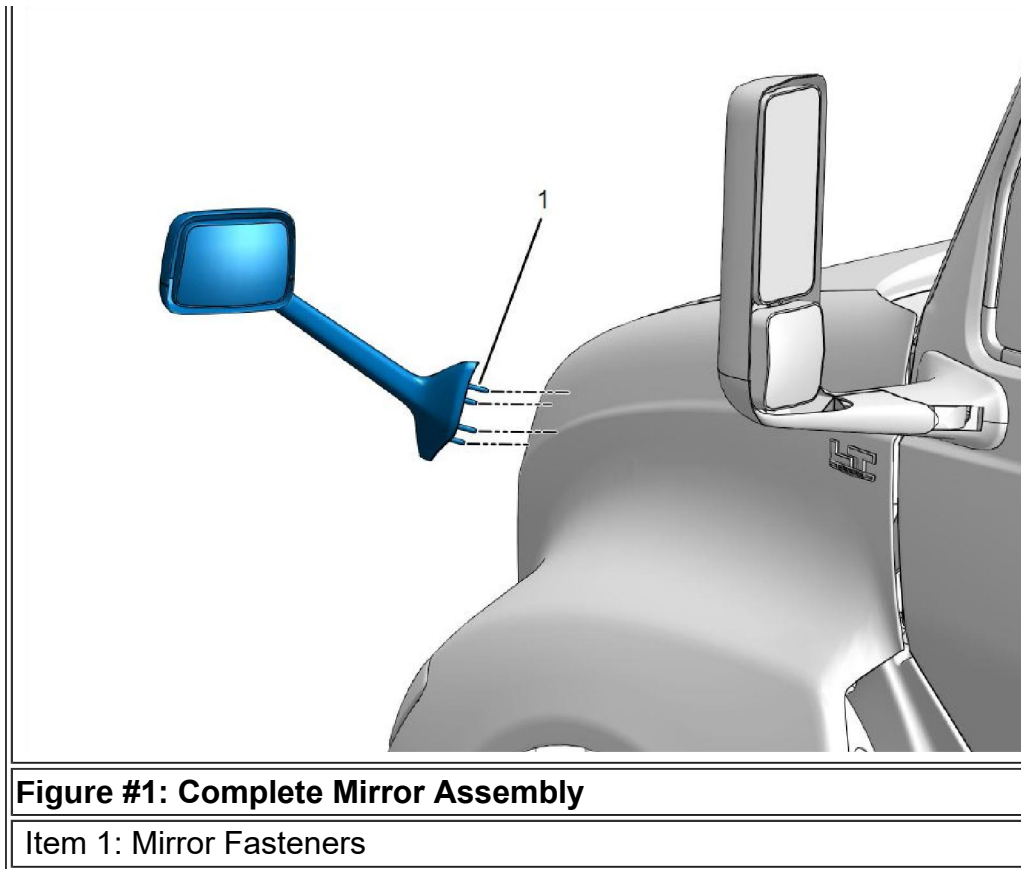

3. Remove complete mirror assembly from vehicle taking care not to damage top coat paint.
4. Reinstall new mirror and torque fasteners to 9-12 ft-lb (12.2 - 16.2 Nm)
5. Close and relatch hood. Readjust mirror glass as needed.

WARRANTY INFORMATION

Warranty Claim Coding:

Refer to the [Warranty Coding Manual](#) for Group and Noun Codes.

Group	Noun
16034	421 - Spot Mirror

Standard Repair Time(s):

Refer to the [SRT Manual](#) for Repair Times

--	--

Group	Noun
LT16-8421A	Hood Mounted Mirror, Replace Left Side
LT16-8421A-11	Hood Mounted Mirror, Replace Right Side
LT16-8421A-12	Hood Mounted Mirror, Replace Both Sides

OTHER RESOURCES

[Master Service Information Site](#)



Hide Details

Feedback Information

Viewed: 1202

Helpful: 9

Not Helpful: 1

No Feedback Found

Copyright © 2018 Navistar, Inc.