

THIS TSB HAS BEEN SUPERSEDED OR DEACTIVATED



TECHNICAL SERVICE BULLETIN

3.2L Diesel - Drive To Clean Maintenance Message And/Or An Illuminated MIL With DTCs P2459, P2463 And/Or P246C

18-2189

02 July 2018

Model:

Ford 2015-2018 Transit	Assembly Plant: Kansas City Assembly Plant Engine: 3.2L Diesel
----------------------------------	---

Issue: Some 2015-2018 Transit vehicles equipped with a 3.2L diesel engine may exhibit "Drive To Clean" maintenance messages and/or an illuminated malfunction indicator lamp (MIL) with DTC P2459, P2463, and/or P246C. Vehicles may also exhibit frequent automatic exhaust regeneration attempts. This may be due to vehicles being used in stationary or off-highway, low speed applications. If automatic regeneration attempts are unsuccessful, these symptoms may be a result of soot accumulation in the diesel particulate filter (DPF). These vehicles may benefit from operator commanded regeneration (OCR) capability so complete regeneration cycles may be performed in a stationary setting.

Action: Follow the Service Procedure steps to correct the condition.

Warranty Status: Information Only.

Repair/Claim Coding

Causal Part:	IN
Condition Code:	04

Service Procedure

OCR will allow the vehicle operator to perform manual regeneration of the DPF without the need to drive the vehicle.

Enable OCR as follows:

1. Connect the appropriate Ford scan tool or equivalent to the data link connector (DLC).
2. Start a new session.
3. Select Module Programming.
4. Select Programmable Parameters.
5. Select Car Configuration Parameter(s).
6. Select Vehicle Configuration in upper left of the screen.
7. Select Retrieve The Vehicle Configuration Data.
8. Select Modify And Reinstate Vehicle Configuration Data.
9. Select parameter for MANUAL REGEN INITIATION.
10. Provide OCR information to the customer.

(1). NOTE: THIS INFORMATION IS ALSO CONTAINED IN THE OWNER'S MANUAL.

© 2018 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy

and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.