

Service Campaign Bulletin



Mercedes-Benz

Campaign No. 2018040008, June 2018

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model A205, Model Year 2018**
Check Luggage Cover

Daimler AG ("DAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain MY18 A205 platform (C-Class Cabriolet) vehicles, the trunk luggage cover may not meet production specifications, which could prevent the convertible top from opening. An authorized Mercedes-Benz will check the luggage cover and replace it if necessary.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 454 vehicles are affected.

Order No. P-SC-2018040008

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Check/test procedure A

1. Move soft top to repair position R2.
☐ **i** For basic data, see AR77.30-P-1030LWR.
2. The marking (dot, (A)) and production date (B) must be checked (figure 1) on the object number adhesive label of the partially electric truck luggage cover.
☐ **i** The marking can be a green, blue or black dot (A).

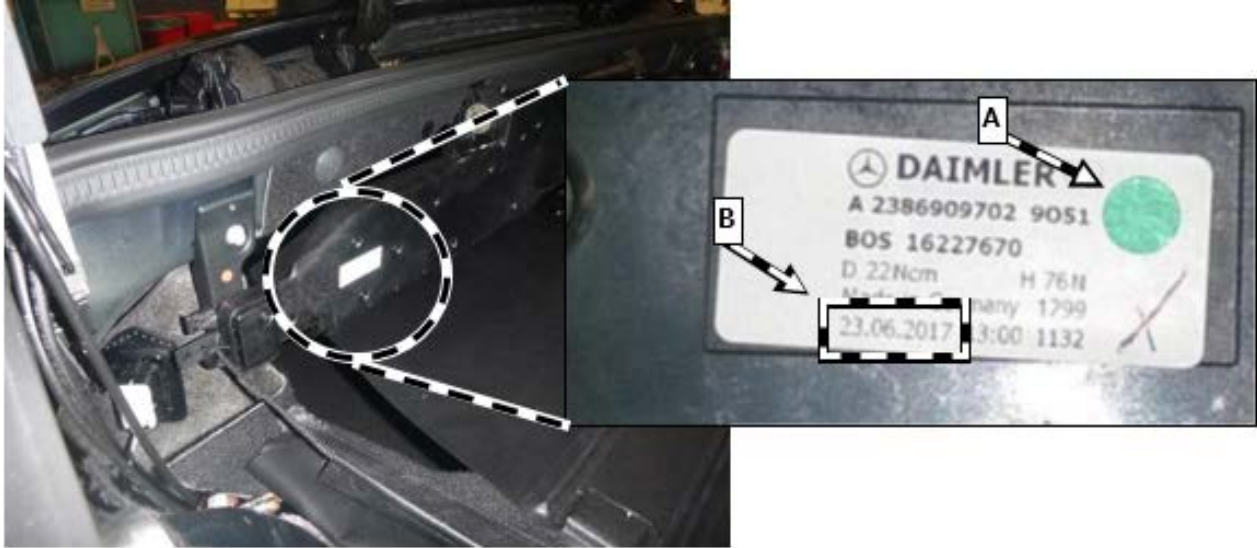


Figure 1

- a. Marking (dot) present :End measure.
- b. Marking (dot) **not** present and production date **same as/later than** 24.06.2017 :End measure.
- c. Marking (dot) **not** present and production date **before** 24.06.2017 :Carry out **check/test procedure B**.

Check/test procedure B

i Check magnetic pockets.

1. Check heat-sealing at both magnetic pockets of partially electric trunk luggage cover (**figure 2**).

i The heat-sealing of the magnetic pockets must be sealed at all 4 sides (**figures 3 (OK image) and 4 (not OK)**).



Figure 2



Figure 3 (OK)



Figure 4 (NOT OK)

i Check rib of housing.

2. Remove cover **(C)** of partially electric trunk luggage cover **(figure 5)**.

i For this purpose, remove all 23 screws and place cover **(C)** to side on net **(figure 6)**.

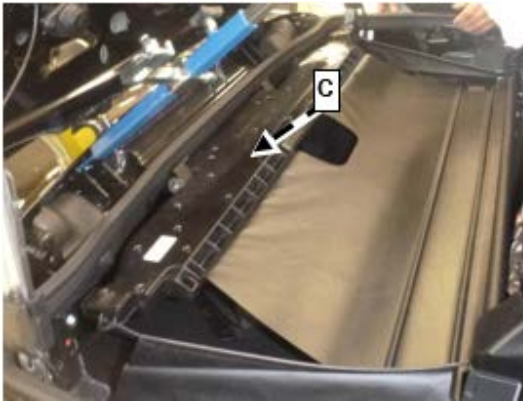


Figure 5

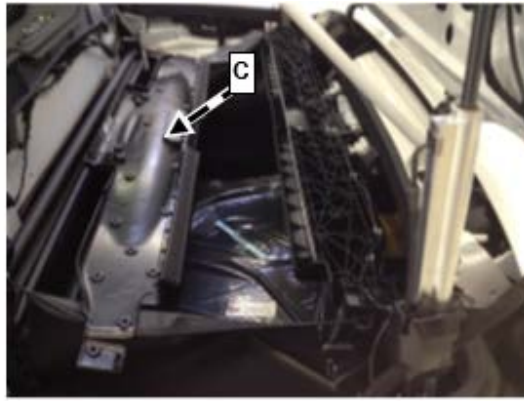


Figure 6

3. Check rib of housing below plunger.

i Rib of housing may not be damaged **(figure 7)**.

i The plunger **(D)** must be able to freely move through the rib **(E)** **(figure 8)**.

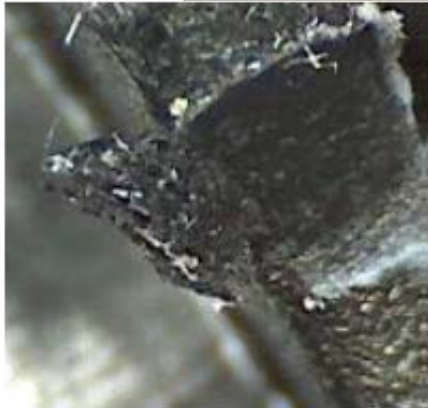


Figure 7 (NOT OK)

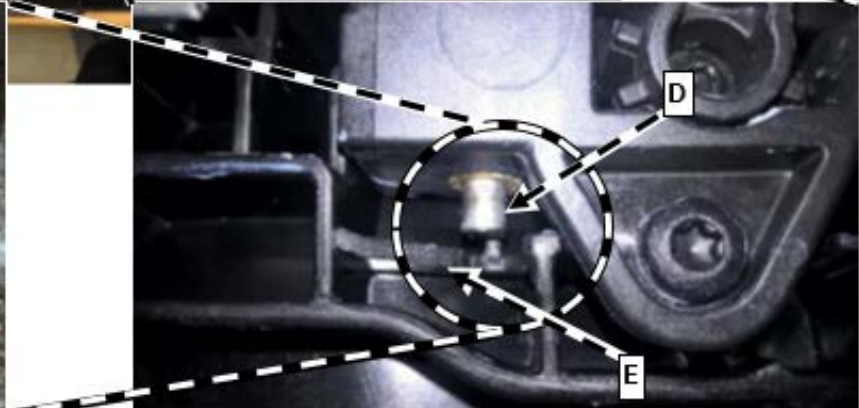


Figure 8 (NOT OK)

- i Check cable set of partially electric trunk luggage cover.
- 4. Check position of flat-wire connectors (**F**) of electrical cable set for drive (**figure 9**).
- i Flat-wire connectors may not lie one above the other (**figure 10 (not OK image)**).



Figure 9

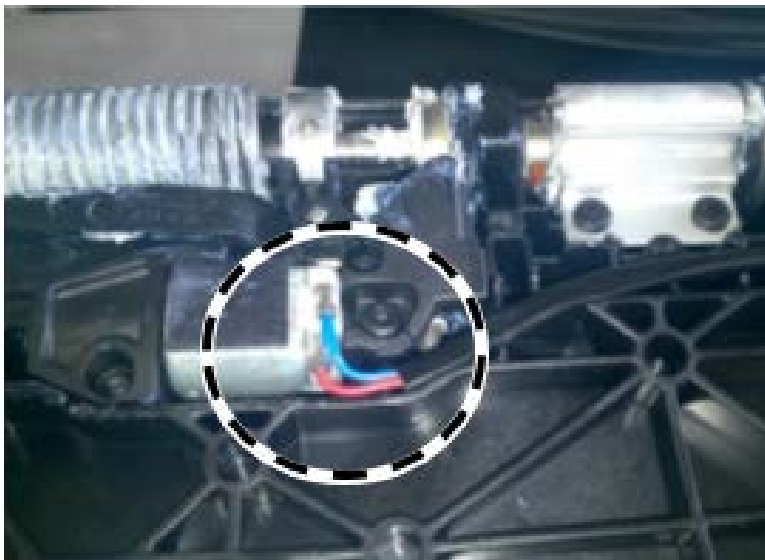


Figure 10 (NOT OK)

5. Check cable set for damage (**figure 11**).



Figure 11 (NOT OK)

- a. All test conditions **OK**:
Assemble in reverse order and **end measure**.
- b. Heat-sealing of magnetic pocket **not OK**:
Carry out **work procedure A**.
- c. Rib of housing below plunger **not OK**:
Carry out **work procedure A**.
- d. Cable set **not OK**:
Perform **work procedures B and C**.
- e. Position of flat-wire connectors **not OK**:
Carry out work procedure C.

Work procedure A


1. Replace partially electric trunk luggage cover.
 **AR68.50-P-3003LWR.**

Work procedure B


1. Repair cable set at damaged location.
 **AR00.19-P-0100A.**

Work procedure C

1. Correctly position flat-wire connectors.
2. Route blue cable (**G**) along threaded connection opening (**figure 12**).
3. Route red cable (**H**) downwards (**figure 12**).

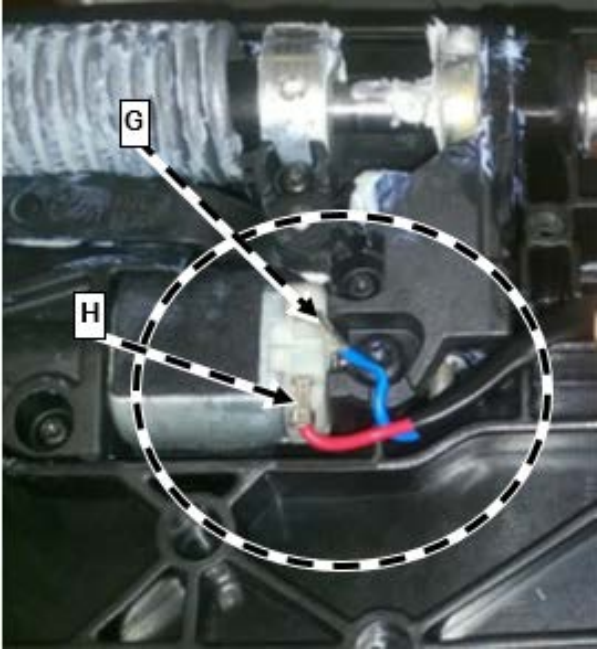**Figure 12**

4. Attach fabric tape (**I**) over red flat-wire connectors (**figure 13**).

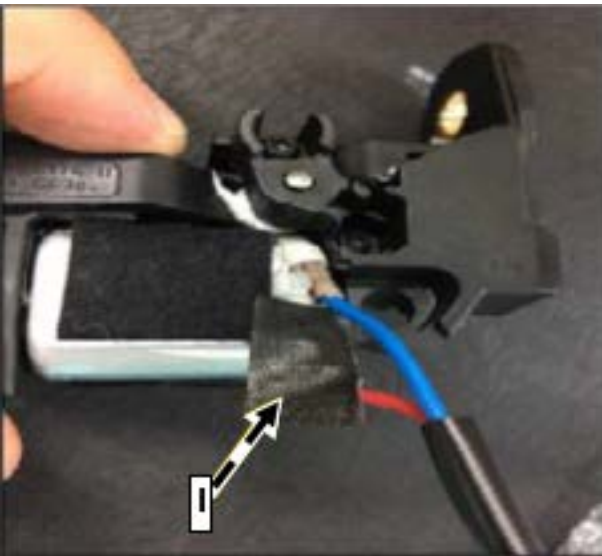**Figure 13**

5. Assemble in reverse order.

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
1	Partition	A 238 690 97 02 9051	15%

Warranty Information**With Check**

Operation: Check adhesive label for trunk separator (02-2265)
Check trunk separator (after check of adhesive label) (02-2266)

Damage Code	Operation Number	Labor Time (hrs.)
67 910 34 8	02-2265	0.2
	02-2266	0.2

With Check and Repair

Operation: Check adhesive label for trunk separator (02-2265)
Check trunk separator (after check of adhesive label) (02-2266)
Replace trunk separator (after check) (02-2267)
Correct installation position of wiring harness for trunk separator (after check) (02-2268)
Correct installation position of male spade connector for electric motor of trunk separator (after check) (02-2269)

Damage Code	Operation Number	Labor Time (hrs.)
67 910 34 7	02-2265	0.2
	02-2266	0.2
	02-2267 *	0.3
	02-2268 **	ZM
	02-2269 ***	0.1

* Work procedure A

** Work procedure B

*** Work procedure C

**Note**

Operation Number labor times are subject to change.