

Technical Service Bulletin

43 Suspension control module is malfunctioning

43 18 29 2051336/1 May 22, 2018.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, A4 allroad, S4, A5, A5 Cabriolet, S5, and S5, Sportback	2017 - 2019	All	Suspension with electronic damper control

Condition

Customer states:

- The warning lamp for damper control on instrument cluster is on.

Workshop findings:

The following DTC may be stored in the drivetrain control module, J775 (address word 0074) or in the electronic damping control module, or J250 (address word 0014):

- DTC B200FF0** (internal malfunction) with symptom code 4456587.

Technical Background

Not applicable.

Production Solution

Not applicable.

Service

 
The DTC does not affect the handling characteristics of the vehicle. Delete the DTC and perform suspension basic settings.

Perform GFF to ensure there are no other DTCs stored in the control module.



Note:

Parts replacement does not solve this issue. Claims for replaced parts will be subject to review.



Technical Service Bulletin

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	4316		
Damage Code:	0040		
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2051336/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB (2051336) are subject to change and/or removal.

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.