

August 24, 2018

Version 1

FM Audio Cuts Out when Using Right Turn Signal

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2018	Accord	EX, EX-L, and Sport	ALL

SYMPTOM

The FM audio cuts out when using the right turn signal.

POSSIBLE CAUSES

There is electrical interference in the tuner feed harness.

CORRECTIVE ACTION

Install a ferrite core onto the tuner feed harness.

REQUIRED MATERIALS

Part Name	Part Number	Quantity
EPT Sealer (One roll repairs about 40 vehicles.)	06991-SA5-000	1

PARTS INFORMATION

Part Name	Part Number	Quantity
Ferrite Core	1N111-5K1-003	1

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
0100A9	Install a Ferrite Core.	0.3 hr	07403	03251	A18085A	32107-TVC-A10

Skill Level: Repair Technician


CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

REPAIR PROCEDURE

1. Remove the right front kick panel, and unplug the tuner feed harness.



2. Cut a 60 mm piece of EPT sealer, measure 25 mm, and make another cut.

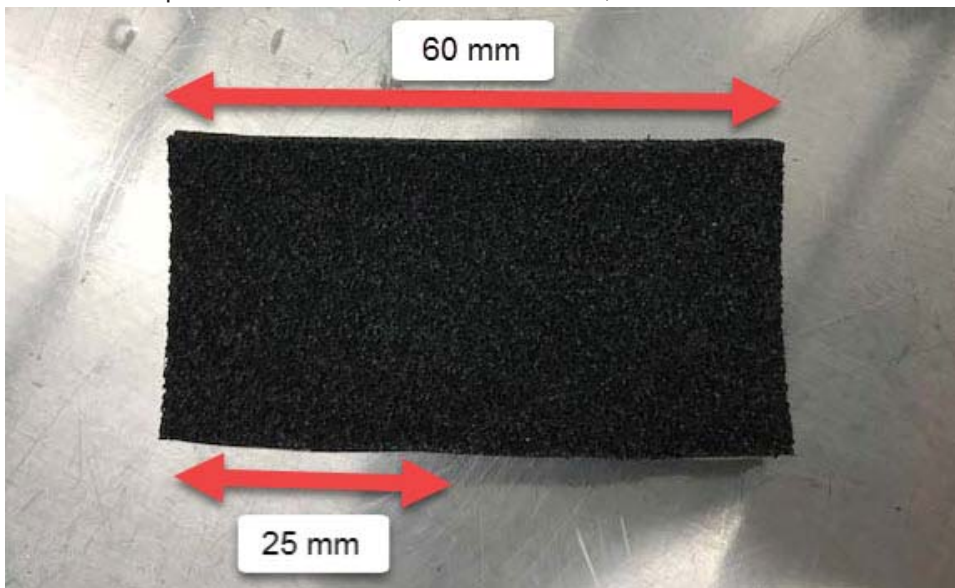

3. Measure 40 mm back from the face of the connector, and apply one of the 25 mm pieces of EPT sealer to the harness.



4. Install the ferrite core and center it around the EPT sealer as shown.



5. Wrap the remaining EPT sealer around the Ferrite Core to secure it in place, and connect the tuner feed harness connector.



6. Install the kick panel.

END