



# Maserati Technical Bulletin


Date: August 13, 2018  
Bulletin No.: MAS001622 – MTB 18-01  
New HVACR S/W for Rear Floor Vents  
Section: HVAC, S/W Update

MASERATI

**Model Type: Quattroporte (M156) Four-Zone (equipped with HVACR module)**

**Model Year: Start of Production up to and including MY 2016**

**Subject: New Software for Rear Floor Vent Operation**

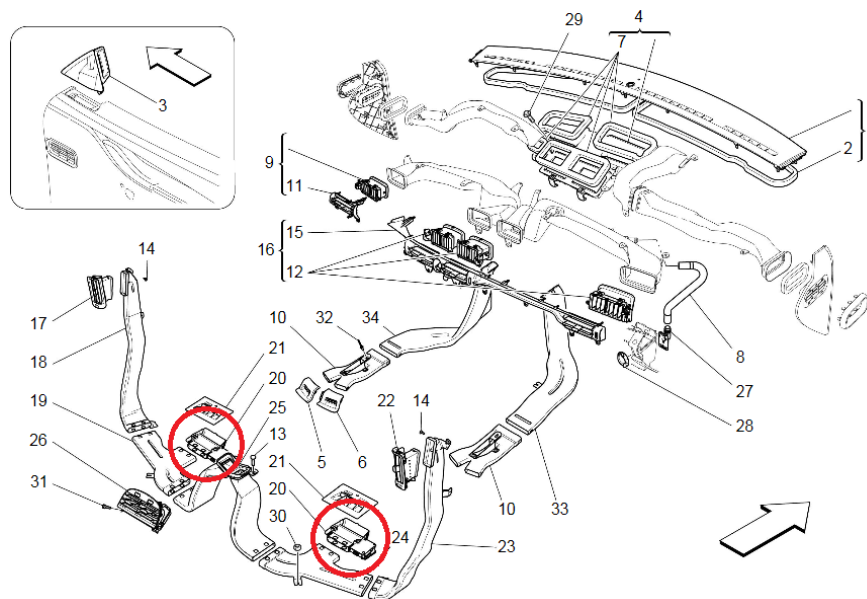

Quattroporte (M156) Four-Zone HVACR vehicles from SOP up to and including MY16, could experience problems with the rear feet air outlet vents due to an HVACR software issue that does not manage the components properly.

A new HVACR software version is now available which will improve the rear feet air outlet vent strategy.

**IMPORTANT:** Only in the case of a customer complaint with the rear feet air vent anomaly or breakage, perform the HVACR software update and replace the rear feet air outlet vent bodies.

In cases of the rear feet air vent bodies with an anomaly or breaking on vehicles from MY17 up to and including MY19, the cause is not related to a software strategy, it will be necessary to open a BOL report so MNA can escalate them to the Factory for Quality analyses.

## PROCEDURES

1. Using the MD/MDEVO, perform the HVACR ECU software update.
2. If the vehicles has an Assembly number below 4010073 (VIN 93098), launch the Active Diagnosis “SELF LEARNING EV PRESENCE” from the HVACR ECU Menu.
3. Check that the Rear AC system functions correctly.
4. The procedure is completed.

## WARRANTY INFORMATION

Fill in the relative Warranty Claims (if any) as follows:

- Cost Code .....16
- Defect Code.....063
- Component Code.....8.49.007
- Operation Code.....8.49.007.9 (0.3h)

Nicola Rosciano  
Manager Technical Support  
Maserati North America, Inc.

Luis Sanchez  
Technical Director  
Maserati North America, Inc.