



Technical Service Bulletin

01 MIL on, DTC P05A0 or P25EA stored in ECM

01 18 67 2048402/2 May 4, 2018. Supersedes Technical Service Bulletin Group 01 number 17-25 dated July 14, 2017 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q7	2017 -2018	All	3.0TFSI Evo

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Service</i> (Added Step 3 and 4) Revised <i>Warranty</i> (Added Labor Operations and Diagnostic Time) Revised <i>Required Parts and Tools</i> (Added table)
1	07/14/2017	Initial publication

Customer states:

- MIL on

Workshop findings:

One of the following DTCs is stored in the engine control module (ECM), J623 (address word 0001):

- **DTC P05A000** (Active Grille Air Shutter "A" Stuck On)
- **DTC P25EA00** (Supercharger Disconnect Clutch Stuck Closed)

Technical Background

Not applicable.

Production Solution

Optimized software with improved diagnostics.



Technical Service Bulletin

Service

Do not replace any parts for these faults. Do not contact Technical Assistance Center (TAC) unless the problem persists after the software update or if there is a problem with the SVM process.

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the engine control module using the SVM action code as listed in the table below if necessary:

Model	Engine and/or Transmission	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Action Code
Q7	CREC	4M0907551 4M0907551A	≤ 0006 ≤ 0005	4M0907551 4M0907551A	0006 0005	01A226

3. **(P05A000 ONLY):** Perform a key cycle. Then set the basic setting for the radiator shutter (OBD >>> 01 ECM >>> Basic Setting >>> Adaptation of radiator shutters). If the basic setting fails or cannot be performed, replace the grille shutter motor per the workshop repair manual.

4. **(P05A000 ONLY):** If the basic setting passes, perform another key cycle and take vehicle on a test drive. If no faults occur, vehicle can be released. If grille shutter faults again, replace grille shutter motor per the workshop repair manual.

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • 1E1 up to 8 Years/80,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If vehicle is outside any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	2470		
Damage Code:	0039		
Labor Operations:	Connect battery charger and perform software update with SVM	2470 2599	50 TU
	Headlight assembly remove + reinstall (If applicable)	See Elsa	See Elsa
	Radiator shutter remove + reinstall (If applicable)	1935 1950	30 TU
Diagnostic Time:	GFF	0150 0000	30 TU



Technical Service Bulletin

	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
Claim Comment:	As per TSB #2048402/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

Part Number	Part Description	Quantity
95B965501S	Motor for adjustment (If applicable)	01

Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All parts and service references provided in this TSB (2048402) are subject to change and/or removal. ©2018 **Audi of America, Inc.** All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.