



Technical Service Bulletin

01 MIL on, DTC P060C00 stored in ECM

01 18 72 2051368/1 May 22, 2018.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
S4, S5, and SQ5	2017 - 2018	All	Not Applicable

Condition

Customer states:

- MIL on.

Workshop findings:

The following DTC is stored in the engine control module (ECM), J623 (address word 0001):

- **DTC P060C00** (Internal Control Module Main Processor Performance).

Note:

Do not replace the ECM for this fault code, an SVM update should be attempted first.

Technical Background

Overly sensitive software diagnostics.

Production Solution

Improved ECM software in production.

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the engine control module (ECM), J623 (address word 0001) using the SVM action code as listed in the table below, if necessary:



Technical Service Bulletin

Model	Engine and/or Transmission	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
S4/S5 (all)	CWGD	8W0907559H	< 0008	8W0907559H	0008	01A234
SQ5	CWGD	80A907559C	< 0007	80A907559C	0007	01A234

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• 1E1 up to 8 Years/80,000 Miles.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	2470		
Damage Code:	0039		
Labor Operations:	Software Update	0151 0000	50 TU
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
Claim Comment:	As per TSB #2051368/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All parts and service references provided in this TSB (2047707) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.



Technical Service Bulletin

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.