

## SERVICE BULLETIN

<b>Reference number:</b>	SB-01-1125	<b>Issued:</b> 20 August, 2018
<b>Subject:</b>	Touch pad cover	
<b>Model(s):</b>	Vantage 19MY	
<b>VIN Range:</b>	N00082 to N00289	
<b>Applicable to:</b>	All Dealers	
<b>Distribute to:</b>	<b>After Sales Manager</b> <b>Executive Manager</b> <b>Service Manager</b> <b>Sales Manager</b>	<b>Warranty Staff</b> <b>Technician(s)</b> <b>Parts Staff</b>

### Reason for this Service Bulletin

Aston Martin has found that the touch pad of some Vantage 19MY vehicles does not operate correctly. The buttons of the touch pad can catch on the touch pad cover.

Do the procedure that follows if a customer has this problem with the touch pad in their vehicle.

### Workshop Procedure

**CAUTION: MAKE SURE THAT NO DAMAGE OCCURS TO THE CABIN TRIM. TOOLS CAN CAUSE DAMAGE IF SUFFICIENT PROTECTION IS NOT USED.**

1. Release the clip that attaches the centre console strap to the centre console assembly (refer to Figure 1).

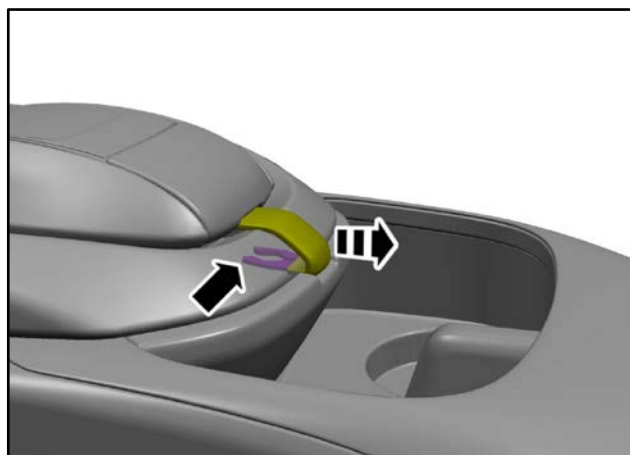


Figure 1

2. Remove the centre console strap (refer to Figure 2).

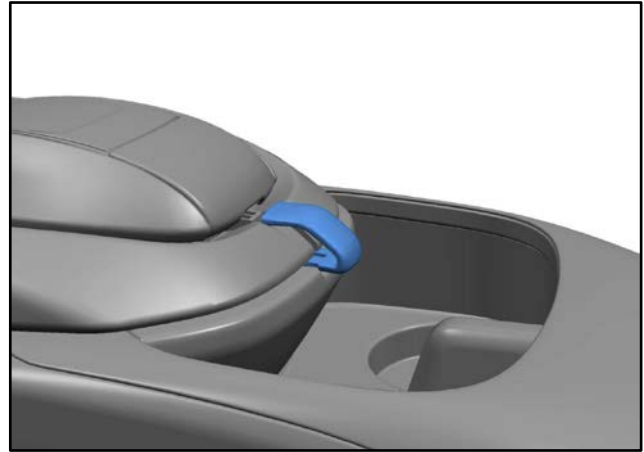


Figure 2

3. Remove the screw that attaches the centre console panel assembly to the centre console assembly (refer to Figure 3).

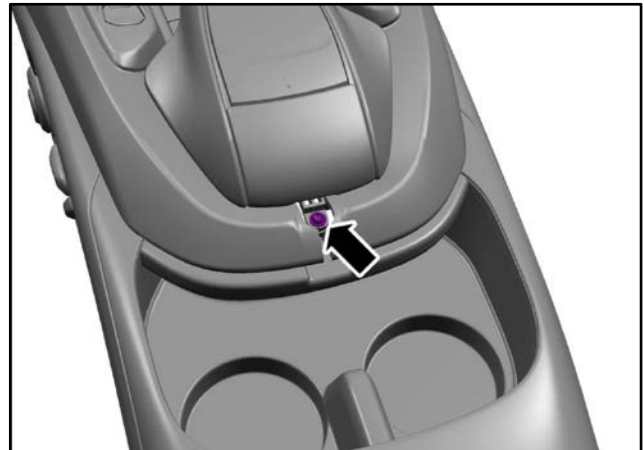


Figure 3

4. Release the touch pad cover from the touch pad module (refer to Figure 4).

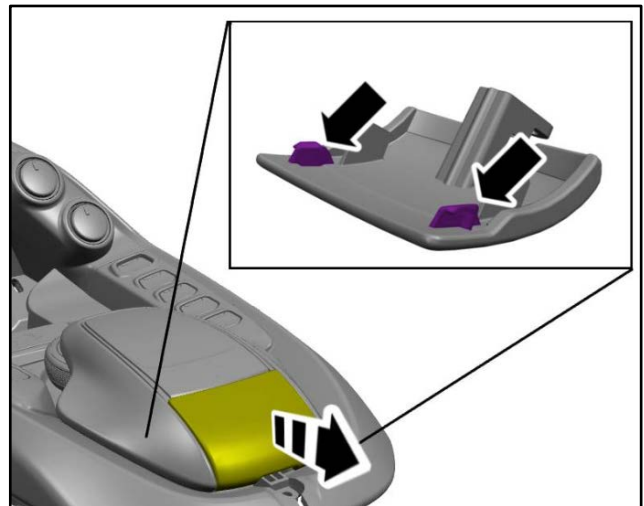


Figure 4

5. Remove the touch pad cover from the touch pad (refer to Figure 5).



Figure 5

6. Extend the screw hole in the touch pad cover by 2 mm to make a slot (refer to Figure 6).

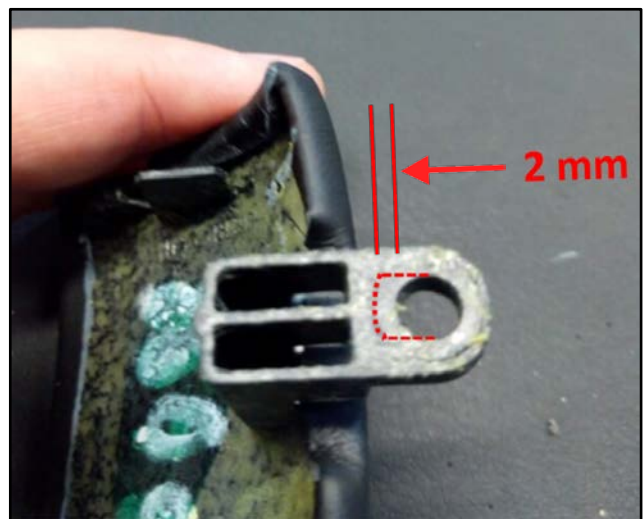


Figure 6

7. Use P80 grade sand paper to remove approximately 1 mm from the bottom of the touch-pad cover moulding (refer to Figure 7).



Figure 7

8. Install the touch pad cover with clearance between the touch pad buttons and the touch pad cover.

- 9. Install the screw that attaches the centre console panel assembly to the centre console assembly (refer to Figure 3).

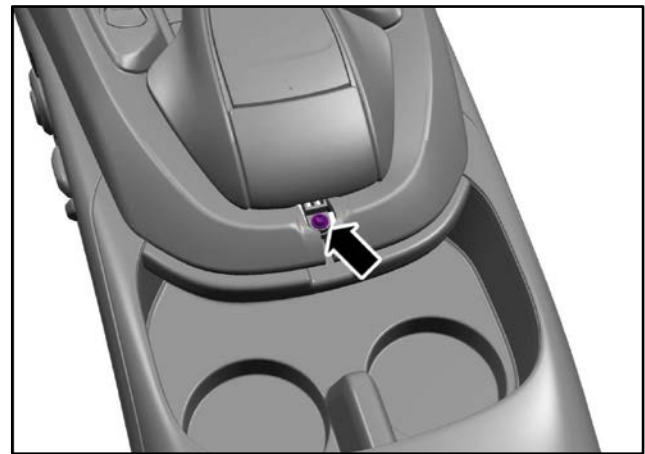


Figure 8

- 10. Make sure that the touch pad buttons operate correctly.
- 11. Install the centre console strap (refer to Figure 2).

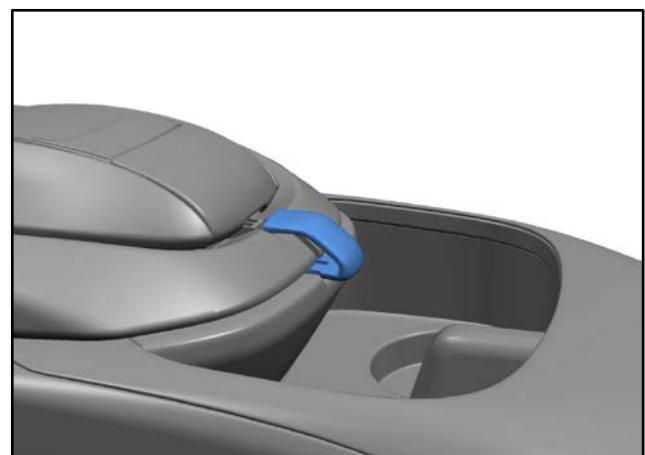


Figure 9

**Part Data**

Not applicable.

**Warranty Data**

**Procedure and Labour Time**

Description	Labour Time	ROT Code
Remove, change and install the touch pad cover.	0.25 hours	01.12.DZ

**Failure Mode Description**

Select the failure modes that follow when you make a claim through the Warranty system:

Subsystem	Location	Component	Mode of Failure
INTERIOR TRIM	CABIN - CENTRE FLOOR CONSOLE	TOUCHPAD TRIM	INOPERATIVE

If you have any questions related to this Service Bulletin, please contact: Aston Martin Technical Services on: +44 (0) 1926 644720, email: askamtech@astonmartin.com, Or contact your After Sales Manager.

The English version of this Service Bulletin is written in Simplified Technical English to ASD-STE100™.