



GROUP  
Electrical

MODEL  
2018MY~  
Rio (SC)

NUMBER  
PS529 (Rev 2, 09/10/2018)

DATE  
November 2017



## TECHNICAL OPERATIONS

SUBJECT: TPMS LAMP ON, TRUNK OPEN LAMP ON,  
AND/OR AUDIO SYSTEM INOPERATIVE

### \* NOTICE

This Pitstop has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.

This Pitstop provides information regarding an inoperative Audio system, TPMS lamp ON, Trunk Open warning lamp ON (even while the trunk is closed), and/or Master Warning Mode lamp ON in the instrument cluster. This condition may be caused by the Transportation Fuse not being fully seated.



Type A cluster



Type B cluster

The 2018MY~ Rio (SC), unlike other Kia models, does not have a “FUSE ON” reminder in the instrument cluster if the transportation fuse is OFF.

Verify that the transportation fuse is ON and fully seated (this can be done by ensuring the yellow transportation fuse tab holder is firmly pressed into the In-Panel Junction Box, located in the lower driver’s side crash pad) and that neither the AUDIO (A) nor ROOM (B) fuses are blown.

