

Subject: ENGINE NO START AND / OR REAR VIEW MONITOR DISPLAY IS BLURRY DUE TO AFTERMARKET ELECTRICAL DEVICE	M-Tips No.: MT-007/18
	Last Issued: 09/14/2018

BULLETIN NOTES

Previous M-Tips:	Date(s) Issued:
MT-007/18	07/20/2018
MT-026/16	2016

APPLICABLE MODEL(S)/VINS

2014-2018 Mazda3
 2014-2018 Mazda6
 2016-2019 CX-3
 2013-2018 CX-5
 2016-2019 CX-9
 2016-2019 MX-5

DESCRIPTION

Some customers may complain about the following:


- Engine no start.
- A blurry rear view monitor display.

This may be caused by an aftermarket accessory device. Some aftermarket electrical devices (e.g., an accessory cell phone charger, **GPS tracker...**) may create excessive electrical noise. The noise may interrupt some of the vehicle electrical systems. Below are a few examples of an aftermarket cell phone charger and **GPS tracker** that are interrupting the vehicle electrical systems.

Example 1

Engine No Start:

Aftermarket Cell Phone Charger connected to 12V outlet	Engine Start/Stop Button Amber Indicator Light Flashing	Key Warning Light (red)
--	--	----------------------------

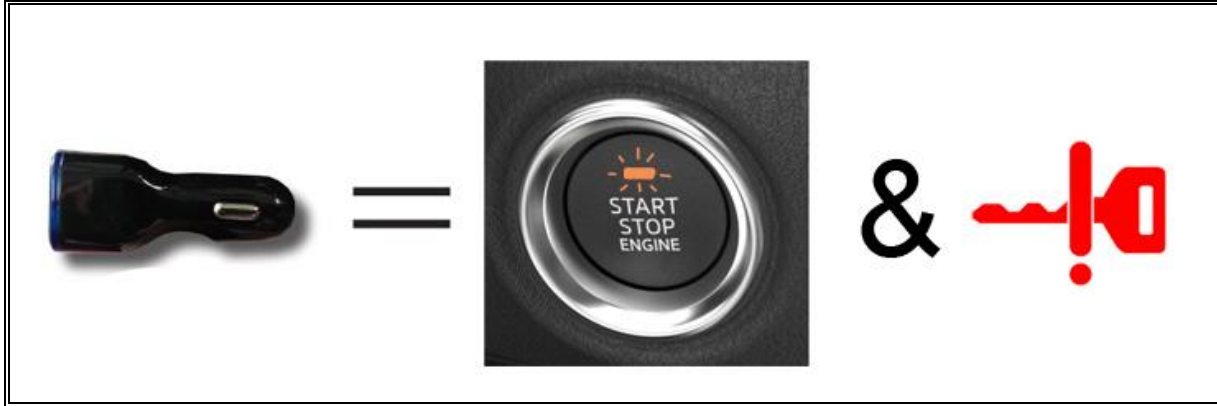

Aftermarket GPS tracking device wired to the power window main switch	Engine Start/Stop Button Amber Indicator Light Flashing	Key Warning Light (red)
---	--	----------------------------



Example 2

Rear View Monitor Display is Blurry:



Warranty Compliance Note: Repairs for this concern are not covered under Mazda’s warranty policy. Advise the customer not to use the aftermarket device that is causing the concern.