Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject: LIGHT RESISTANCE AND/OR UNUSUAL NOISE WHEN TURNING STEERING WHEEL TO THE LEFT	Bulletin No.: 06-002/18
	Last Issued: 09/14/2018

APPLICABLE MODEL(S)/VINS

2016-2018 CX-3 vehicles with VINs lower than JM1 DK**** ** 326595 (Produced before Dec. 14, 2017)

DESCRIPTION

Some vehicles may exhibit a light resistance and/or an unusual noise when turning the steering wheel to the left. This concern may be caused by insufficient lubrication of the gear due to uneven and deteriorated grease. To eliminate this concern, the production process for steering shaft has been modified.



Page 1 of 5

REPAIR PROCEDURE

1. Verify the customer concern.

2. Inspect the label on the bottom of the steering motor. Record the 2nd, 3rd and 4th digits of the lot number.

NOTE: The red circle shown below is the steering motor part number.



Example: The lot number in the sample part below is "CE62116". The 2nd, 3rd and 4th digits are "E62".



Page 2 of 5

Bulletin No.: 06-002/18	Last Issued: 09/14/2018

3. Using the three (3) digits found from the lot number inspection, determine the necessary action using the table below.

2nd, 3rd and 4th Digits of Lot Number	Necessary Action
D**, E**, F** or G**	Proceed to Step 4 of this bulletin and replace the steering shaft with a
H1* to H9*, HA* to HB* (except HBX)	modified part.
HBX to HC*	
J**, K** or L**	This bulletin does not apply. The steering shaft is already modified, do not replace it. Refer to MGSS online for further diagnosis.

* can be any number or letter.

Examples:

- E62 = Proceed to Step 4 of this bulletin and replace the steering shaft with a modified part. •
- HCA = This bulletin does not apply. The steering shaft is already modified, do not replace it. Refer • to MGSS online for further diagnosis.

4. Replace the steering shaft with a modified one according to the instructions on MGSS online: STEERING WHEEL AND COLUMN REMOVAL/INSTALLATION.

5. Verify the repair.

Page 3 of 5

PARTS INFORMATION

Parts Number	Description	Qty.	Notes
DB4G-32-100J	Shaft, Steering	1	2016-2017 CX-3
DH1E-32-100C	Shaft, Steering	1	2018 CX-3
B455-32-099B	Shaft, Bolt	1	[R]
D10J-32-099	Shaft, Bolt	1	[R]

NOTE1: The steering shaft part numbers have not been changed by this modification. Refer to the lot number inspection above to determine if the steering shaft is a modified part or not.
NOTE2: Select applicable steering shaft according to the GEPC.
[R] = Replace

WARRANTY INFORMATION

NOTE:

• This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.

• This repair will be covered under Mazda's New Vehicle Limited Warranty term.

• Additional diagnostic time cannot be claimed for this repair.

Warranty Type	А
Symptom Code	31
Damage Code	91
Part Number Main Cause	DB4G-32-100J or DH1E-32-100C
Quantity	1
Related Part Number	B455-32-099B (Shaft bolt)
Quantity	1
Related Part Number	D10J-32-099 (Shaft bolt)
Quantity	1
Operation Number / Labor Hours:	XXP66XRX / 0.9 Hr. (includes steering shaft unit, RR)

Page 4 of 5

Bulletin No.: 06-002/18	Last Issued: 09/14/2018

Page 5 of 5