



SI M51 06 16
Body Equipment

June 2018
Technical Service

SQUEAKING NOISE FROM POWER FOLDING EXTERIOR REARVIEW MIRRORS


New information provided by this revision is preceded by this symbol .

This Service Information bulletin replaces SI M51 06 16 dated **August 2016**

What's New:

- Changed production date of affected vehicles
- Repair procedure, parts, and warranty updated

MODEL

F54 (Cooper Clubman / Cooper S Clubman)	F55 (Cooper hardtop 4 door / Cooper S hardtop 4 door)	F56 (Cooper hardtop 2 door / Cooper S hardtop 2 door)	F57 (Cooper Convertible) / Cooper S Convertible)
Vehicles with Option Code 313 Power Folding Mirrors			
 Produced up to November, 2017			


SITUATION

A squeaking noise can be heard when folding the exterior rear view mirrors in or out.

CAUSE

The rubber seal between the folding components can rub together, causing a squeak.

CORRECTION

 Replace both exterior rear view mirrors with updated parts.

PROCEDURE

For conditions similar to those described:

1. Reference vehicle history to determine if the mirrors have been replaced previously.
2. Have the mirrors been replaced after June 4, 2018?

NO: proceed to step 3.

YES: Continue troubleshooting, as this SI M does not apply.

3. Replace both exterior side view mirrors following repair instructions REP 51 16 000 “**Removing and installing/replacing the left or right exterior mirror on the front door**”. As of June 4, 2018, any mirror ordered will be an optimized replacement part.

UPDATE! **PARTS INFORMATION**

Part Number	Description	Quantity
Refer to ETK	Outside mirror without glass right	1
Refer to ETK	Outside mirror without glass left	1

UPDATE! **WARRANTY INFORMATION**

Covered under the terms of the MINI New Passenger Car Limited Warranty.

Defect Code:	6713053900	
Labor Operation:	Labor Allowance:	Description:
51 16 020	Refer to KSD2/AIR	Removing and installing/replacing both outside rearview mirrors on the Front doors (Main work)
Or:		
51 16 520	Refer to KSD2/AIR	Removing and installing/replacing both outside rearview mirrors on the Front doors (Plus work)

If you are using a Main labor code for another repair, use the Plus code labor operation 51 16 520 instead of 51 16 020.

Posted: Tuesday, June 12, 2018

[Copyright ©2018 BMW of North America, Inc.]