



# Preliminary Information

## PIC6215A AC Inoperative and/or Ambient Temperature Display Missing from the Radio

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Sonic	2012 - 2018	All	All	All	All
Chevrolet	Trax	2015 - 2018	All	All	All	All
Chevrolet	Spark	2013 - 2018	All	All	All	All
Buick	Encore	2013 - 2018	All	All	All	All

<b>Involved Region or Country:</b>	<b>North America</b>
<b>Condition:</b>	<b>AC inoperative and/or ambient temperature display missing</b>
<b>Cause:</b>	<b>open circuit to the ambient temperature sensor</b>

**Correction:**

Dealer to isolate and repair open circuit to the ambient temperature sensor.

**Service Procedure:**

Use GDS2 to check ambient temperature in the IPC data.

If it reads -40 there is an open to the ambient temperature sensor.

This leads to the radio not displaying a temperature and AC is also inoperative.

Check for unplugged connectors or damaged harness to the ambient temperature sensor.

Version History

Version	2
Modified	09-13-2016 - Created 09-14-2018 - Updating Model Years

