



Preliminary Information

PIP5302A Service Engine Lamp - Possible Misfire With Codes - After Completion of Customer Satisfaction Program 15169B

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	City Express	2015	All	All	All	All

Supersession Statement

This PI was superseded to update Condition\Concerns, Recommendations\Instructions. Please discard PIP5302.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern

A technician may find after performing repairs in customer satisfaction program (CSP) 15169B the SES lamp illuminated and a possible low engine power condition present.

Any or all of the following dtcs may be set in the ECM: P0011, P0075, P0300, P0301, P0302, P0303 and / or P0304.

This condition can be caused by splicing together the incorrect wires or a poor splice connection after performing the repair procedure for CSP 15169B .

Recommendations / Instructions

Verify correct wires were spliced together during the repair by reviewing step #8 of CSP 15169B.

The largest gauge red and largest gauge purple wires are utilized for this repair.

If the incorrect wires were spliced: Return wires to original routing and re-perform the splice repair utilizing the correct wiring, clear the dtcs and re-evaluate.

If the correct wires were spliced: Evaluate the crimp utilized at the splice for a poor connection, correct as needed.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



GENERAL MOTORS