



LTB01052NAS1

TECHNICAL BULLETIN

20 JUN 2018

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

SECTION:

501-03: Body Closures

SUBJECT/CONCERN:

Clicking Noise From Tailgate Strut Covers

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Discovery Sport (LC)	2015-2018	501001-750577	Halewood

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:**SITUATION:**

On vehicles with a power tailgate, a clicking noise may be evident when opening the power tailgate and/or the power tailgate strut cover(s) may be loose/adrift.

CAUSE:

This may be caused by poor component sealing allowing water to enter the power tailgate strut.

ACTION:

Should a customer express this concern, follow the Workshop Procedure below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY
LR115494	Left power tailgate strut	1
LR115493	Right power tailgate strut	1
LR006101	Tailgate trim panel clips	9

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:**NOTES:**

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to JLR claims submission

system to obtain the latest repair time.

- The JLR Claims Submission System requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Tailgate - Powered - Struts - Pair - Renew	76.28.81	0.2	63	LR115493 / LR115494
Calibrate - Tailgate - Powered - Struts	86.95.08	0.2	63	LR115493 / LR115494

NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:

- 1 Replace the power tailgate struts (see TOPIx Workshop Manual section 501-03: Body Closures - Power Tailgate Actuator).