



LTB01207NAS1

TECHNICAL BULLETIN

29 JUN 2018

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

SECTION:

307-05: Automatic Transmission

SUBJECT/CONCERN:

Rattle From Under Vehicle / Transmission Heatshield Mounting Bracket Cracked

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:	APPLICABILITY:
LR4 (LA)	2014-2016	679426-847658	Solihull	V6 S/C 3.0L Petrol

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:**SITUATION:**

A rattle/vibration may be evident from under the vehicle when driving on an uneven surface.

CAUSE:

This may be caused by a cracked transmission heatshield mounting bracket.

ACTION:

Should a customer express this concern, follow the Workshop Procedure below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY
LR073535	Transmission heatshield mounting bracket	1
LR044464	Foam pad	4

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:**NOTES:**

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to JLR claims submission system to obtain the latest repair time.

- The JLR Claims Submission System requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.


DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Replace and modify transmission heatshield mounting bracket	05.10.40	0.4	01	LR073535

△ NOTE:

Normal Warranty procedures apply.


WORKSHOP PROCEDURE:

1

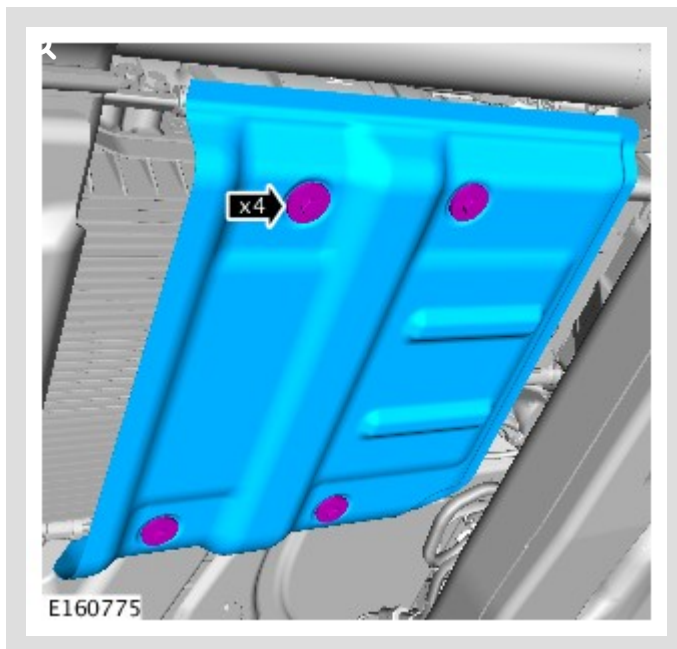


Remove the transmission heatshield.

2

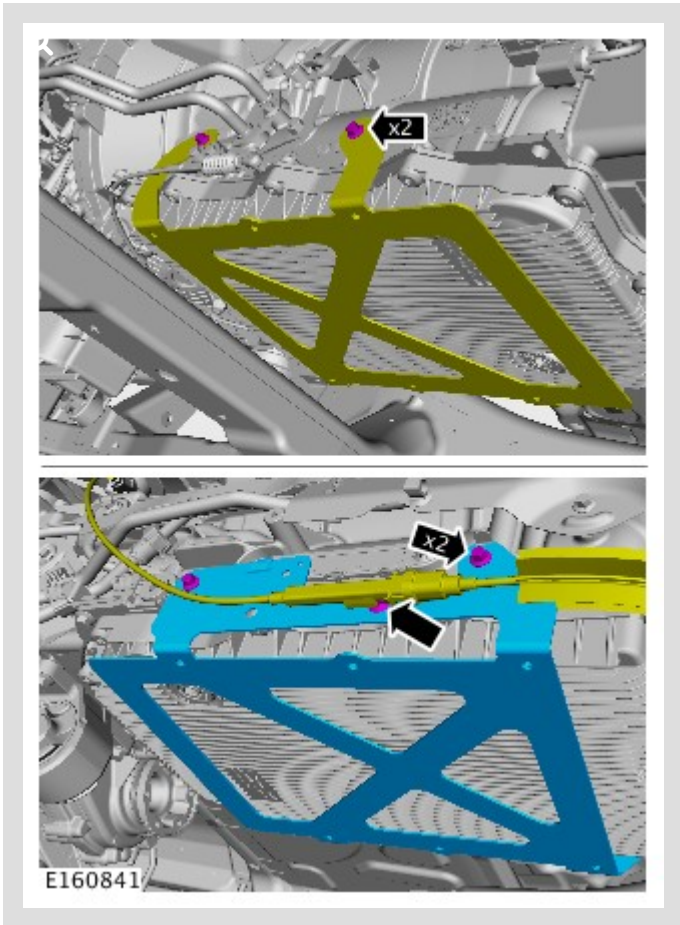

Remove and discard the transmission heatshield mounting bracket.


3

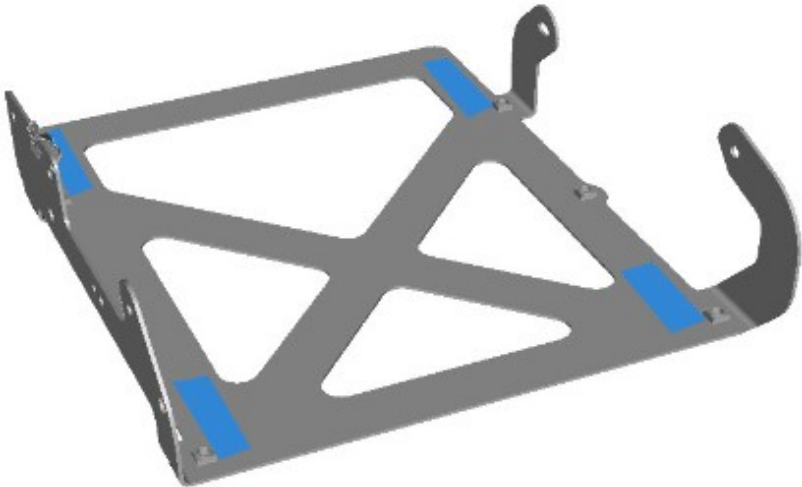

E229024

Install the foam pads onto the new heatshield mounting bracket.


4

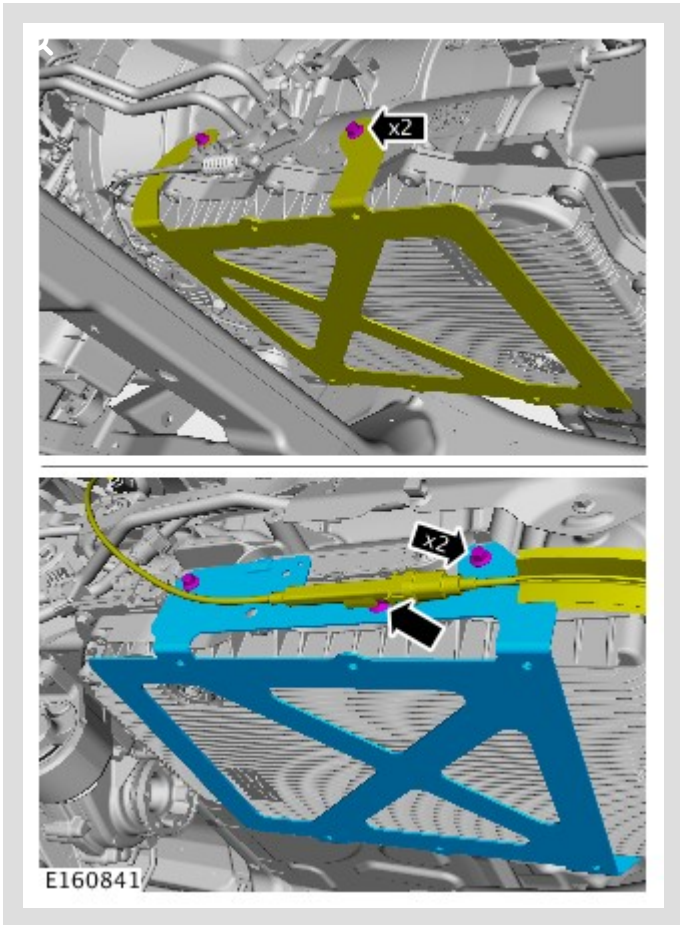

Install the transmission heatshield mounting bracket.

- Torque: **9 Nm**

5

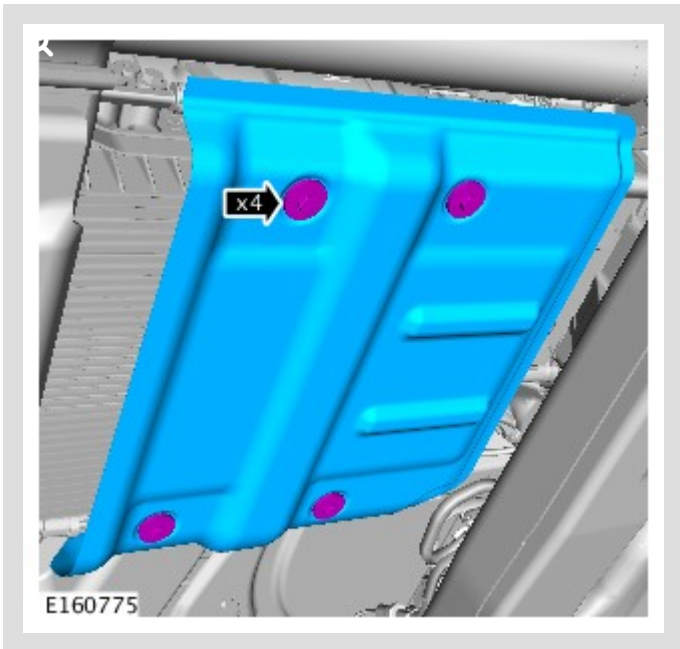

Install the transmission heatshield.

- Torque:**9 Nm**