



Technical Service Bulletin

55 Rear lid gesture-controlled operation does not work, DTC U115200 stored in comfort control module

55 18 43 2051804/1 July 17, 2018.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2017 - 2018	All	With advanced key (hands free trunk opening)
A5, Q5	2018	All	With advanced key (hands free trunk opening)

Condition

Customer states:

- The gesture-controlled rear lid operation does not work.

Workshop findings:

The following DTC is stored in the comfort system central control module, J363 (address word 0046):

- DTC U115200** (Control module for rear lid opening no communication).

Technical Background

Incorrect software in the rear lid opener control module, J938.

Production Solution

Not applicable.

Service

- Verify the condition listed above.
- Perform a reset of the comfort control module 0046 by removing the following fuses from the Relay and fuse carrier 2 (SR2), located in the left rear of the vehicle.

Perform reset with the ignition (KL15) off.

- ST1-SF9
- ST1-SF11
- ST3-SF14




Technical Service Bulletin

3. Wait 30 seconds with all three fuses removed.
4. Reinstall the three fuses.
5. Perform an ignition cycle.
6. If the functionality of the gesture controlled rear lid is restored, no further repairs can be made. This TSB will be updated once software is available to resolve the condition.
7. In the event that functionality is not restored, continue diagnostics with ODIS Guided Fault Finding.

Fuse Reference Chart				
Image Reference	Fuse Panel	Panel Color	Fuse Number	Fuse Rating
A	ST1	Black	9	20A
B	ST1	Black	11	20A
C	ST3	Brown	14	20A

! Note:

In the event that the fuse listed in this TSB does not match the fuse installed in the vehicle, reference the applicable wire diagram for your vehicle.

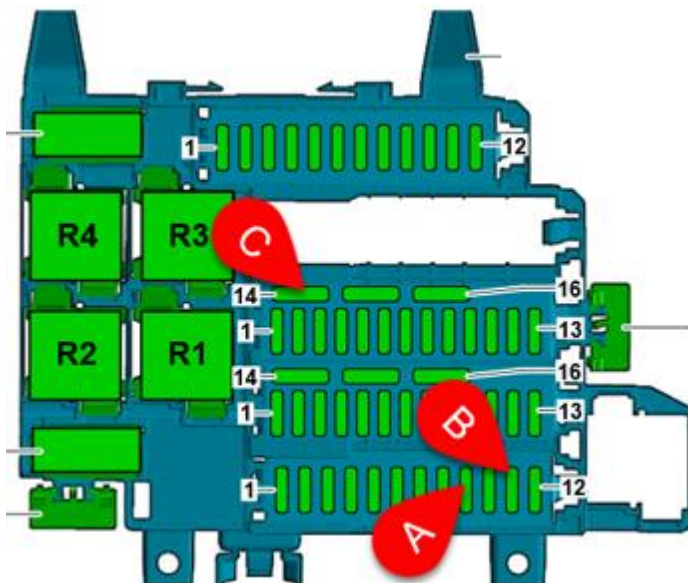



Technical Service Bulletin

Figure 1. Q5 (FY) Fuse Locations: A: ST1-SF9. B: ST1-SF11. C: ST3-SF14.


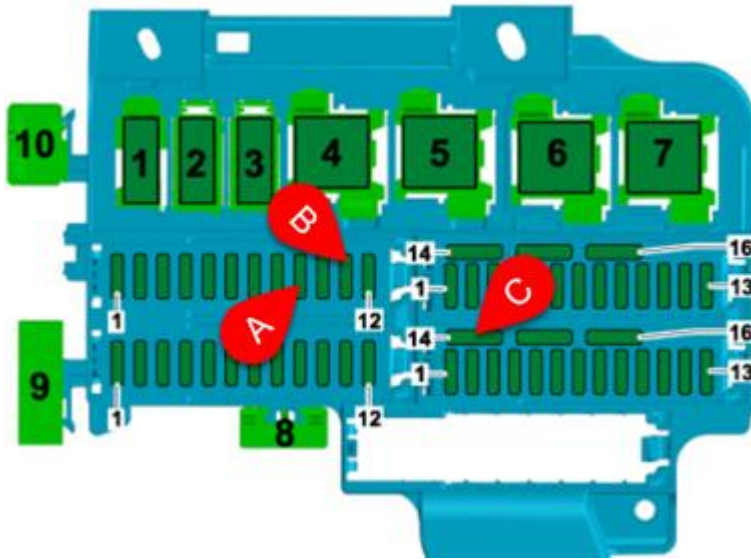


Figure 2. A5 Cabriolet Fuse Locations: A: ST1-SF9. B: ST1-SF11. C:ST3-SF14

 

Technical Service Bulletin

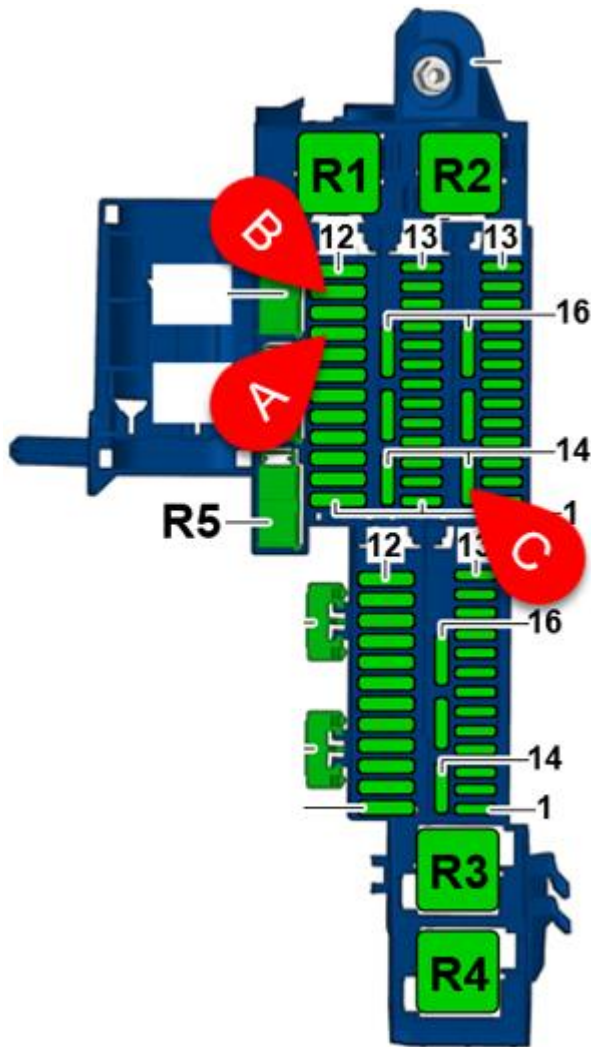


Figure 3. A4, A5 Coupe, and A5 Sportback Fuse Locations: A: ST1-SF9. B: ST1-SF11. C: ST3-SF14.



Technical Service Bulletin

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9660		
Damage Code:	0040		
Labor Operations:	Repair comfort system control unit	5789 4199	20 TU
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 100 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2051804/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB (2051804) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.