



Technical Service Bulletin

90 Various messages displayed, DTCs B200FF1 and/or B200FF2 stored in the camera control module

90 18 94 2048926/2 July 10, 2018. Supersedes Technical Service Bulletin Group 90 number 17-82 dated September 26, 2017 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, Q7	2016 - 2018	All	With multifunction camera
A5, A5, Cabriolet, and Q5	2018	All	With multifunction camera

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised title Revised <i>Warranty</i> (Updated Labor Operations) Revised <i>Required Parts and Tools</i> (Updated part numbers)
1	09/26/2017	Initial publication

Customer statement:

In the driver information system (DIS) one or several of the following messages are displayed:

- Audi pre sense: malfunction.
- Traffic sign detection: malfunction.
- Adaptive cruise control with congestion assistant is not available.
- Audi active lane assist: currently not available.

Workshop findings:

One of the following DTC(s) is stored in the camera control module, R242 (address word 00A5) as either static or sporadic:

- **DTC B200FF1** (internal malfunction).
- **DTC B200FF2** (internal malfunction).

Technical Background

During its start phase the camera recognizes a malfunction in the internal communication.



Technical Service Bulletin

Production Solution

Analysis is ongoing.

Service

1. If only **DTC B200FF1** (internal malfunction) is logged, then replace the camera control module.
2. If both **DTCs B200FF1** and **B200FF2** are logged, then replace the camera control module.
3. If only **DTC B200FF2** (internal malfunction) is logged, proceed as follows:
 - Delete the DTC.
 - If the DTC is not logged again, return the vehicle to the customer. It is not necessary to replace the front camera.
 - If the DTC stays active or is logged again, then replace the camera control module.

Note:

Claims with a replaced camera control modules which only had the **DTC B200FF2** once may be denied.

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If vehicle is outside any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	9638		
Damage Code:	0040		
Labor Operations:	All Models:		
	Camera Driver Assist Sys Adjust	9638 1550	40 TU
	Preparation Driver Assist Calibration	9092 0050	30 TU
	Vehicle front + rear checked	4495 0100	70 TU
	A4 and A5:		
Camera Driver Assist Sys replaced	9638 5550	60 TU	



Technical Service Bulletin

	Inside mirror remove and reinstall	6827 1900	20 TU
	A5 Cabriolet:		
	Camera Driver Assist Sys replaced	9638 5500	110 TU
	Q5:		
	Camera Driver Assist Sys replaced	9638 5500	60 TU
	2 Headlight assembly adjust Or 2 Headlight assembly adjust	9415 1600 Or 9415 1601 (LED-Matrix Only)	20 TU Or 30 TU
	Q7:		
	Camera Driver Assist Sys replaced	9638 5550	20 TU
	Inside mirror removed + reinstalled	6827 1900	20 TU
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 100 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
Claim Comment:	As per TSB #2048926/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Front Camera for driver assistance programs	01
4M0955609	Silicone pad for front camera	01



Technical Service Bulletin

See ETKA	Fasteners, Bolts, Nuts and Screws as needed per the Repair Manual	See ETKA/ELSA
----------	---	---------------

Additional Information

All parts and service references provided in this TSB (2048926) are subject to change and/or removal.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.