

Technical product information

Topic	Flying Spur - Rearview camera coding message
Market area	United States E05 Bentley USA and rest America (6E05)
Brand	Bentley
Transaction No.	2052111/2
Level	EH
Status	Approval
Release date	

New customer code

Object of complaint	Complaint type	Position
driver assist systems, convenience features -> parking aid, park assist system, rear traffic alert -> reversing camera picture	functionality -> faulty display	
driver assist systems, convenience features -> parking aid, park assist system, rear traffic alert -> reversing camera picture	functionality -> faulty	

New workshop code

Object of complaint	Complaint type	Position
driver assist systems, convenience features -> Park Assist, parking aid -> reversing camera	functionality -> without function / defect	

Vehicle data

Flying Spur

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
4W2*	2018	E		*	*	*
4W2*	2019	E		*	*	*

Chassis numbers

Manufacturer	Filler	Type	Filler	MY	Factory	From	To	Prod from	Prod to
SCB	*	*	*	*	C	069140	999999		
SCB	ET9	ZA	8	J	C	068725	068725		

Documents

Document name
master.xml

Customer statement / workshop findings

When using Offboard Diagnostic Information System (ODIS) a message relating to 006C – Camera System Rear View not coded is shown on the diagnostic tester screen

Technical background

The prompt is mainly evident when the Model/Engine type is selected

Production change

No further improvement can be offered, the issue affects all Flying Spur vehicles within the applicable VIN range.

All affected VIN's have 0040 software installed within the rear view camera control unit

Measure

Referring to Figure 1, When the screen is shown **ALWAYS** select **CLOSE**

- Although the rear view camera is shown as not coded, this should be ignored as the camera is coded correctly, the prompt has no negative effect on the performance of the rear view camera system

WARNING

Do not under any circumstances select Perform coding as the warning message shown in Figure 2 will remain present

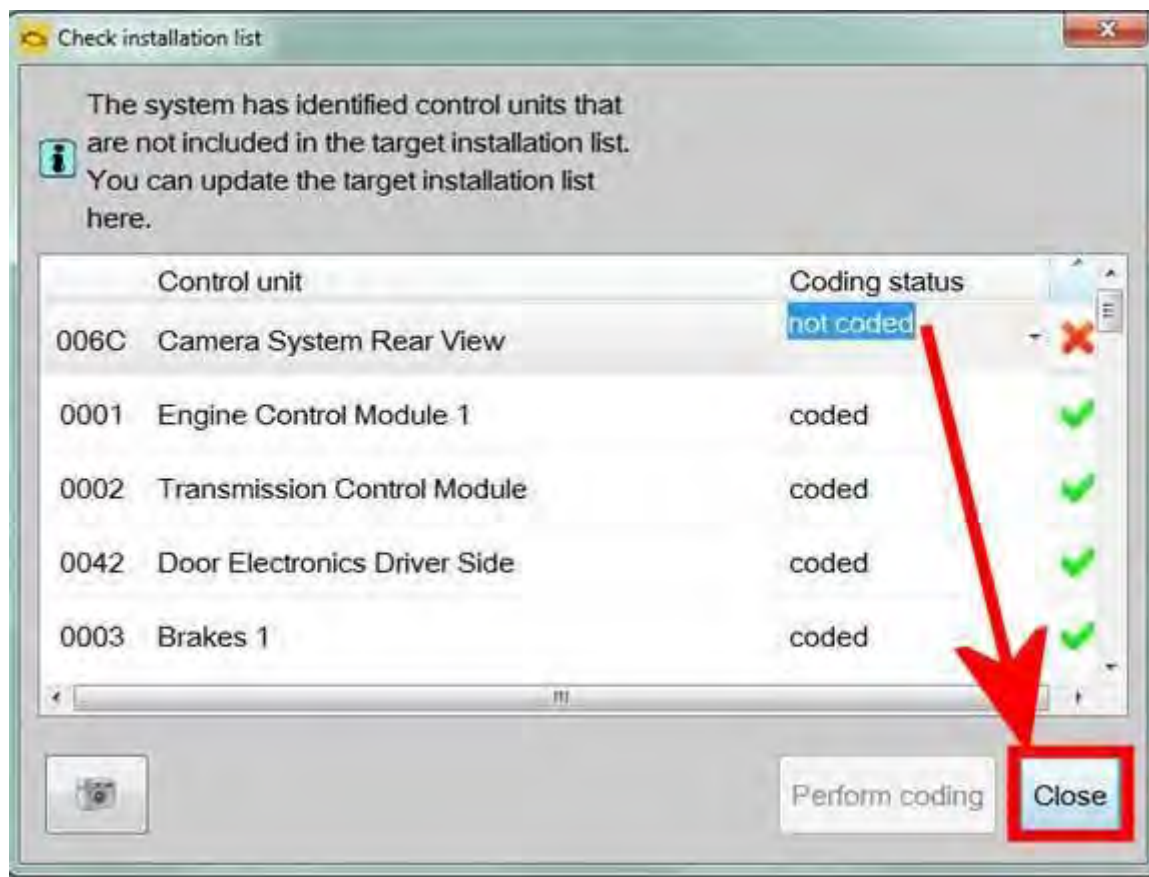


Figure 1



Figure 2

The following DTC's should be ignored do not take any investigative action in response to the following fault codes unless there is an actual fault evident in the system or a fault in one of these systems has been reported by the owner

- Rear view camera DTC (Address 006C) - SBBE/03006 000 Control module incorrectly coded
- Gateway DTC (Address 0019) – SBBE/03006 000 Rear view camera system not calibrated